

General Information

Date & Time: 13, Jan, 2026 15:57

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,236
Registration No.	GBC2614	Chassis No.	PA1B18F39P4234828
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



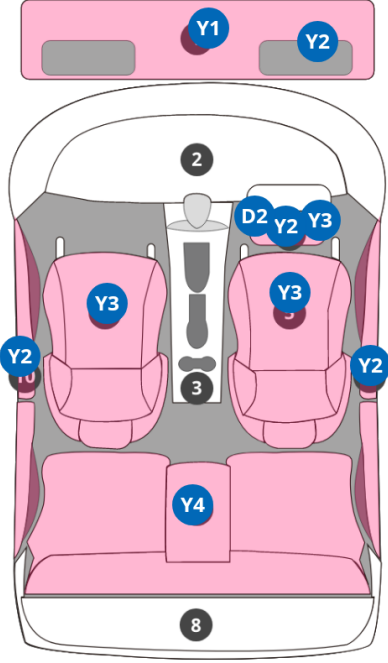
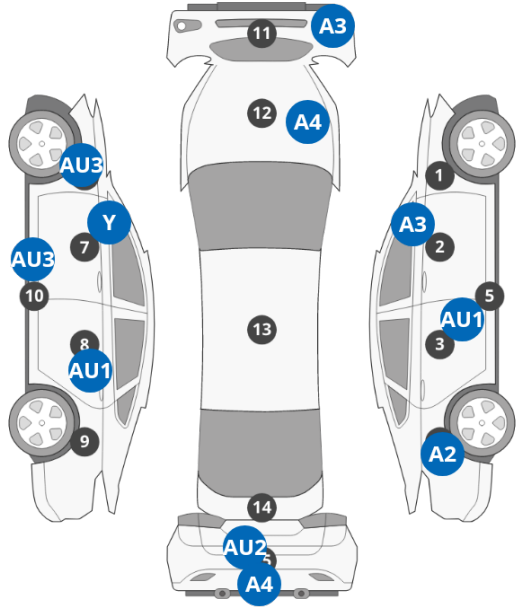
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	112	105	128
2	Boot Lid	105.1	99	108	108
3	Roof	102.0	109	106	94/100
4	Left Front Fender	100.7	103	100	99
5	Left Front Door	104.3	103	106	104
6	Center Panel Left				
7	Left Rear Door	110.0	116	109	105
8	Left Back Panel	115.0	130	105	110
9	Right Front Fender	108.3	103	106	116
10	Right Front Door	106.3	104	105	110
11	Center Panel Right				
12	Right Rear Door	112.0	117	106	113
13	Right Back Panel	117.6	111	110	132

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Crack - Damaged / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Left side mirror issue. With warranty booklet and spare tire. Without jack, tools and seat cover. 1 key. Temporary plate. No LTO plate.</p>