

General Information

Date & Time: 10, Jan, 2026 18:53

Make	Toyota	Model	Wigo
YOM	2019	Odo Meter Reading	98,145
Registration No.	EAC1305	Chassis No.	MHKA4D5FJJ024715
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



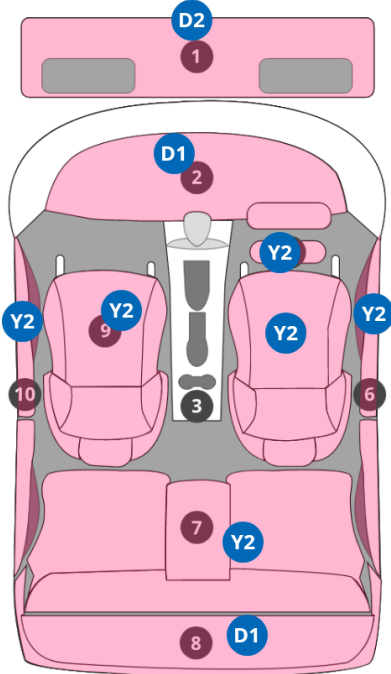
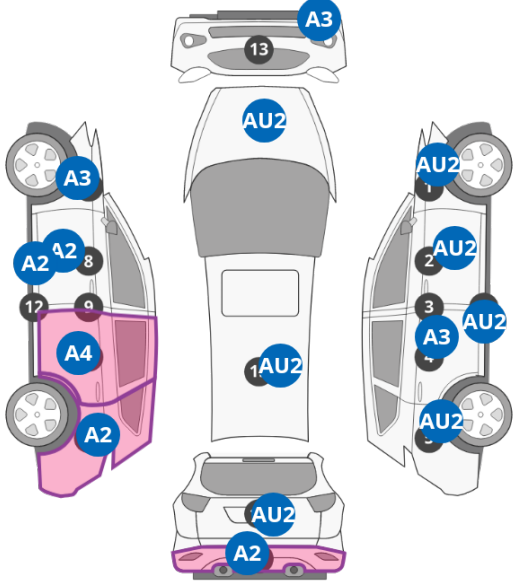
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.0	108	100	95
2	Boot Lid	128.0	110	137	137
3	Roof	62.2	52	72	61/65
4	Left Front Fender	99.5	103	106	90
5	Left Front Door	88.3	90	87	88
6	Center Panel Left				
7	Left Rear Door	114.3	120	107	116
8	Left Back Panel	108.0	123	101	100
9	Right Front Fender	95.0	78	120	87
10	Right Front Door	111.0	101	114	118
11	Center Panel Right				
12	Right Rear Door	133.3	171	120	109
13	Right Back Panel	122.6	104	135	129

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Dashboard - Worked - Minimal / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Trunk Room - Worked - Minimal / Ceiling - Crinkle - Small	Remarks (R) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, no spare key, no reverse camera, no warranty and manual booklet, scratches on taillight.