

General Information

Date & Time: 12, Jan, 2026 11:33

Make	Mitsubishi	Model	Strada
YOM	2018	Odo Meter Reading	118,860
Registration No.	CA07970	Chassis No.	MMBJYKK10JH056318
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Pearl White		

Body / Panel Condition



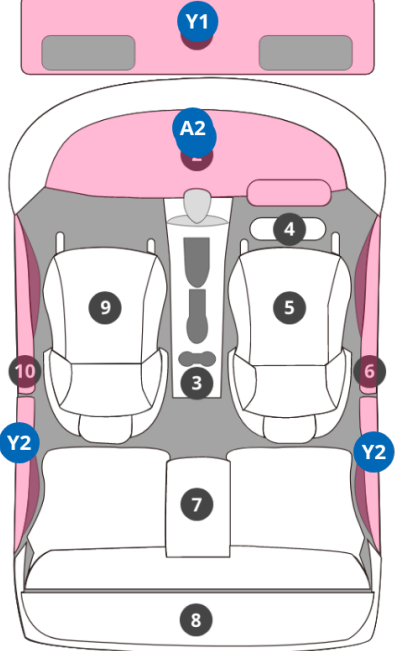
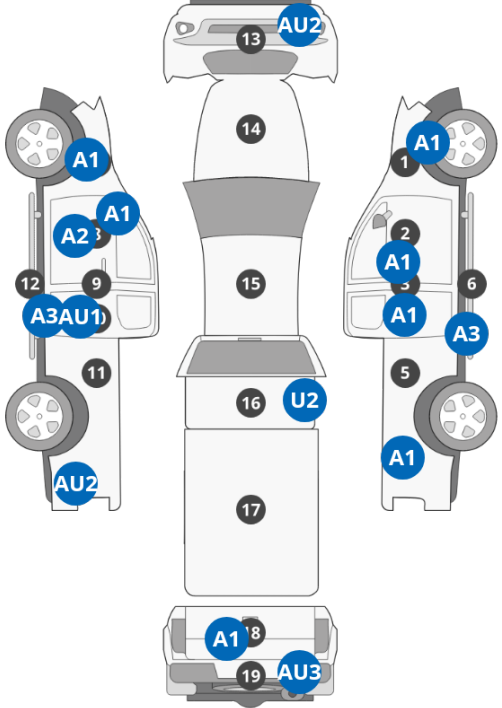
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	263.3	350	285	155
2	Boot Lid	104.7	107	108	99
3	Roof	103.0	86	80	145/102
4	Left Front Fender	123.3	109	151	110
5	Left Front Door	109.6	112	111	106
6	Center Panel Left				
7	Left Rear Door	105.0	101	102	112
8	Left Back Panel	111.0	104	104	125
9	Right Front Fender	107.6	100	107	116
10	Right Front Door	190.3	283	141	147
11	Center Panel Right				
12	Right Rear Door	158.3	130	136	209
13	Right Back Panel	101.0	112	102	89

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Side Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Dent - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
<p>With Lto plate, with spare tire, with warranty booklet, 1key, no jack and tools, rear door issue,sunglasses holder issue,scratches on headlights and taillights</p>