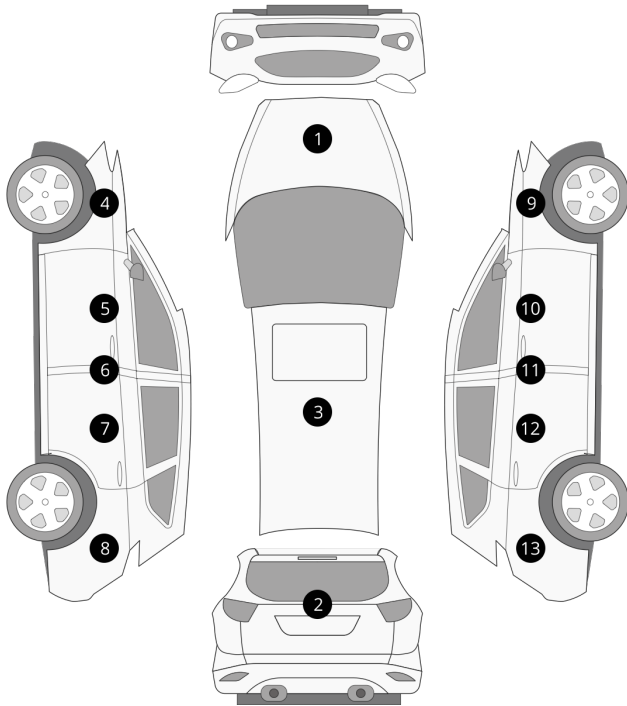


General Information

Date & Time: 09, Jan, 2026 15:54

Make	Hyundai	Model	Elantra
YOM	2017	Odo Meter Reading	71,882
Registration No.	NCP4308-SELLER'S YARD	Chassis No.	KMHD741CBHU418847
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



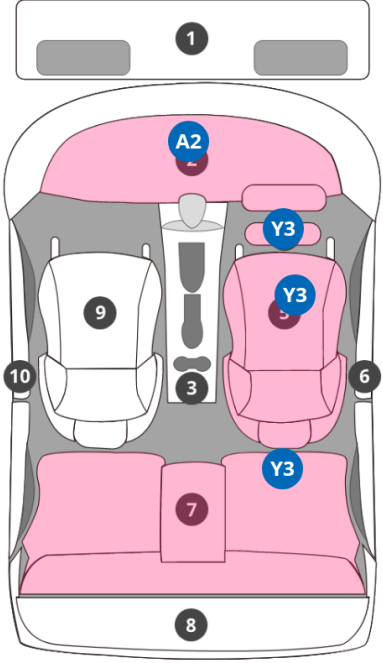
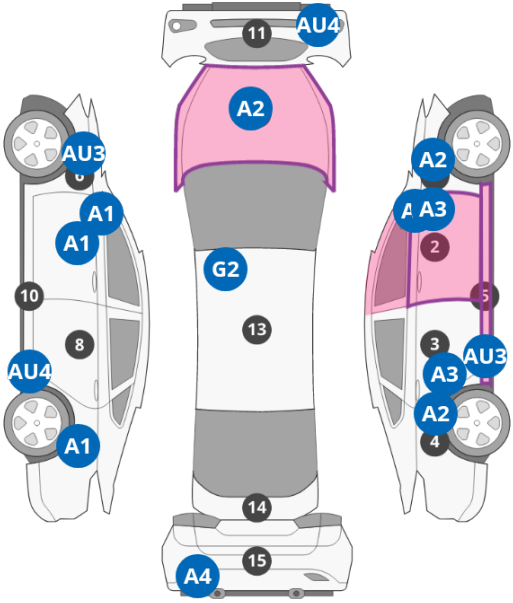
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	152.6	142	151	165
2	Boot Lid	139.0	148	131	138
3	Roof	146.2	148	142	151/144
4	Left Front Fender	148.3	144	180	121
5	Left Front Door	143.0	159	135	135
6	Center Panel Left				
7	Left Rear Door	159.0	179	152	146
8	Left Back Panel	152.0	188	145	123
9	Right Front Fender	185.6	205	180	172
10	Right Front Door	238.6	226	300	190
11	Center Panel Right				
12	Right Rear Door	161.0	175	152	156
13	Right Back Panel	144.0	125	136	171

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is". NCP4308-SELLER'S YARD. This report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Windshield - Scratch, Stone chip - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches and cracked headlight and taillight,</p>