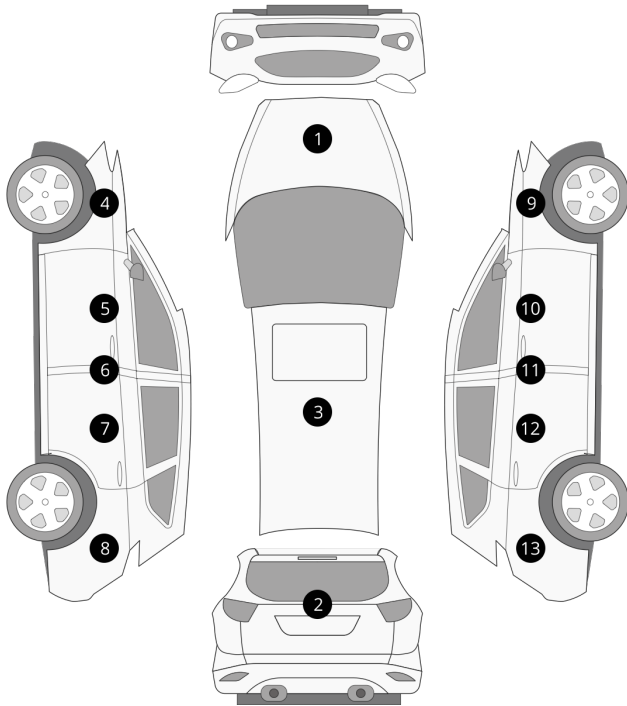


General Information

Date & Time: 09, Jan, 2026 15:55

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	40,400
Registration No.	NFP1356-SELLER'S YARD	Chassis No.	PAEA13TJPNA000846
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



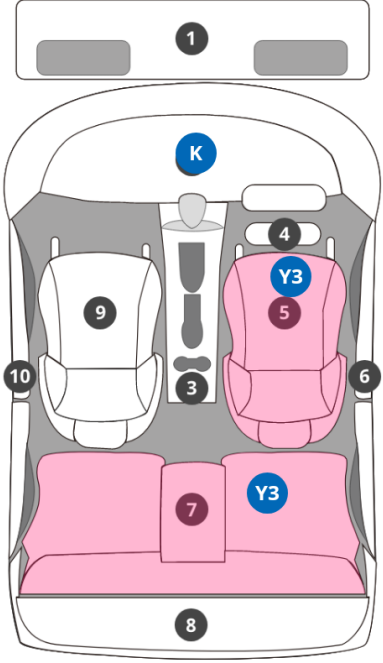
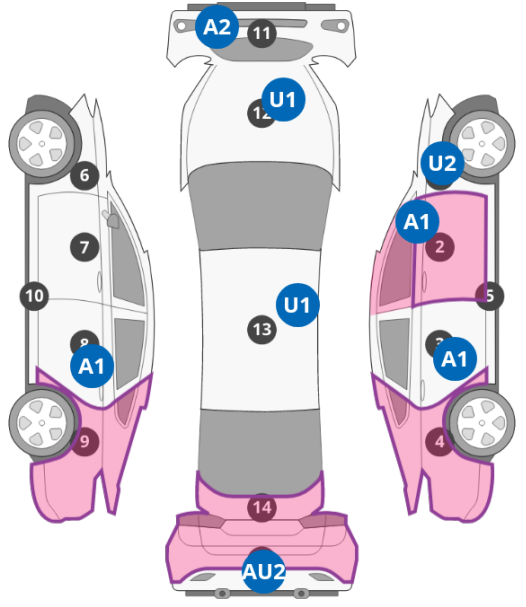
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	120	126	135
2	Boot Lid	157.6	163	150	160
3	Roof	101.4	102	103	100/101
4	Left Front Fender	115.6	113	111	123
5	Left Front Door	103.6	102	104	105
6	Center Panel Left				
7	Left Rear Door	101.0	104	96	103
8	Left Back Panel	171.3	170	169	175
9	Right Front Fender	115.6	112	114	121
10	Right Front Door	152.3	134	154	169
11	Center Panel Right				
12	Right Rear Door	110.0	110	105	115
13	Right Back Panel	360.6	820	135	127

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is". NFP1356-SELLER'S YARD This report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Dent - Minimal / Roof - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, 1key, no spare tire, no jack and tools, scratches on headlight</p>