

General Information

Date & Time: 10, Jan, 2026 11:01

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	15,516
Registration No.	CCF1174	Chassis No.	MHFAB1BY0R3095568
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



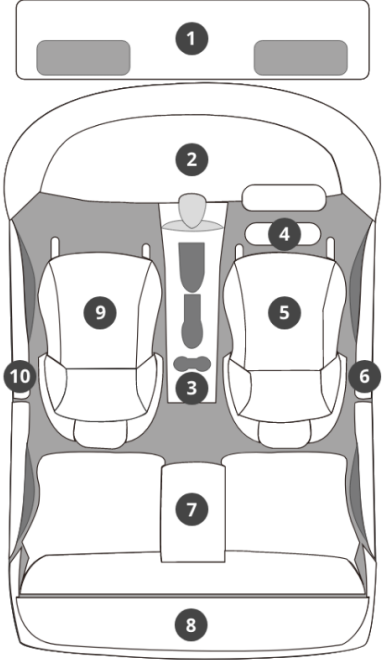
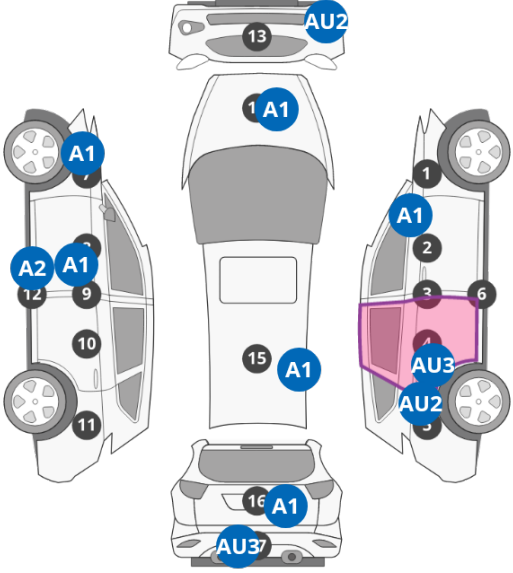
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	101	95	103
2	Boot Lid	96.7	83	107	100
3	Roof	105.6	109	115	103/96
4	Left Front Fender	93.0	98	90	91
5	Left Front Door	111.6	105	109	121
6	Center Panel Left				
7	Left Rear Door	121.3	121	117	126
8	Left Back Panel	116.6	126	120	104
9	Right Front Fender	100.8	97	103	103
10	Right Front Door	143.3	175	133	122
11	Center Panel Right				
12	Right Rear Door	196.6	144	158	288
13	Right Back Panel	111.3	101	112	121

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet, no tools,scratches on headlights and taillights