

General Information

Date & Time: 10, Jan, 2026 19:01

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	80,102
Registration No.	DAR4119	Chassis No.	JTFJT02P8N5031407
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



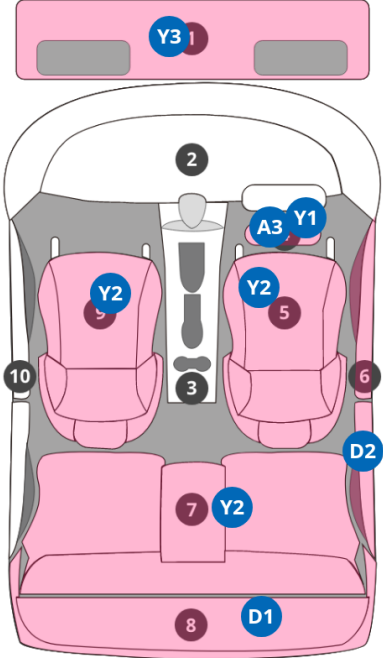
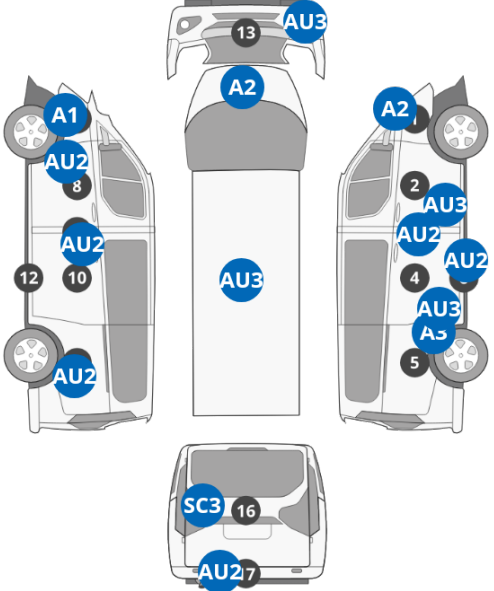
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	62.6	63	63	62
2	Boot Lid	67.5	76	67	60
3	Roof	69.8	90	62	59/68
4	Left Front Fender	74.8	84	70	71
5	Left Front Door	56.7	62	53	55
6	Center Panel Left	61.9	61	66	59
7	Left Rear Door				
8	Left Back Panel	57.6	56	60	57
9	Right Front Fender	74.3	71	83	69
10	Right Front Door	57.6	55	55	62
11	Center Panel Right	57.2	63	58	51
12	Right Rear Door	64.7	74	68	53
13	Right Back Panel	85.8	65	93	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Medium / (R) Rear Trim - Worked - Small / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal</p>		<p>Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch - Small / Roof - Scratch & Dent - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
no LTO plate, scratches and dent in taillight, no spare key, with warranty and manual booklet, no reverse camera, no tools & jack.