

General Information

Date & Time: 10, Jan, 2026 11:07

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	40,720
Registration No.	NEW9655	Chassis No.	MHKA4DF5FMJ056890
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



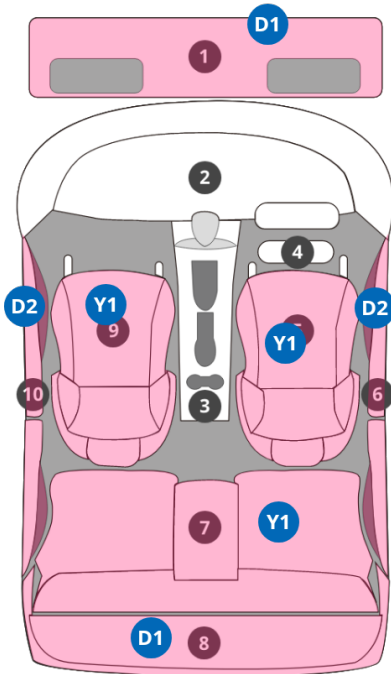
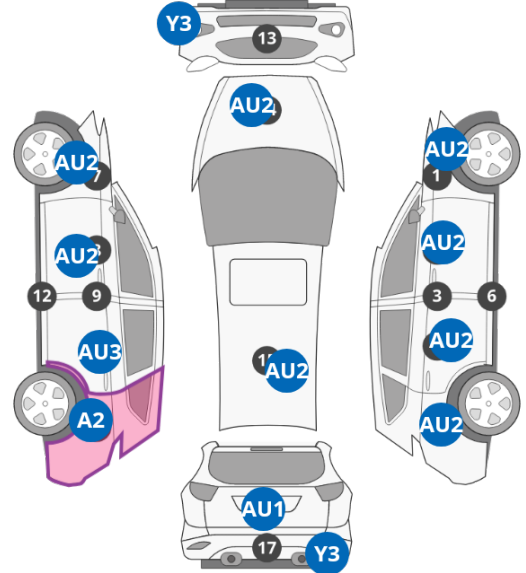
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	78.0	68	86	80
2	Boot Lid	101.3	92	106	106
3	Roof	83.0	76	80	82/95
4	Left Front Fender	138.0	133	150	131
5	Left Front Door	98.3	99	102	95
6	Center Panel Left				
7	Left Rear Door	102.6	106	104	98
8	Left Back Panel	276.0	312	235	281
9	Right Front Fender	107.3	133	115	74
10	Right Front Door	99.0	97	100	100
11	Center Panel Right				
12	Right Rear Door	156.3	155	159	155
13	Right Back Panel	101.6	94	99	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	D
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Crinkle - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Worked - Minimal</p>		<p>Remarks (L) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Roof - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small</p>	
Frame Evaluation :	C	Functional Evaluation :	A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
with spare tire, with reverse camera, no LTO plate, no Warranty & manual booklet, issue on foglamps, no tools & jack, scratches on taillight and headlight.