

General Information

Date & Time: 10, Jan, 2026 11:07

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	54,091
Registration No.	NID1395	Chassis No.	PA1B18F35N4184443
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



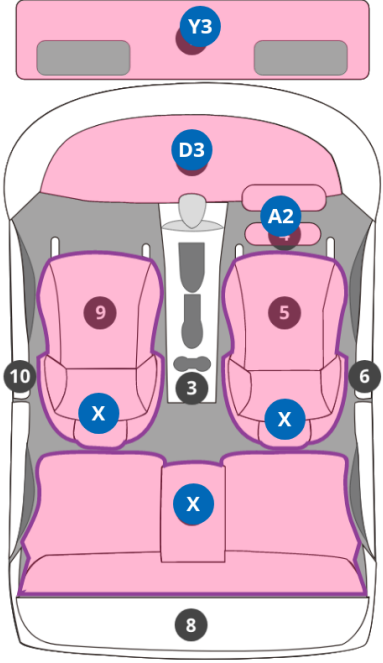
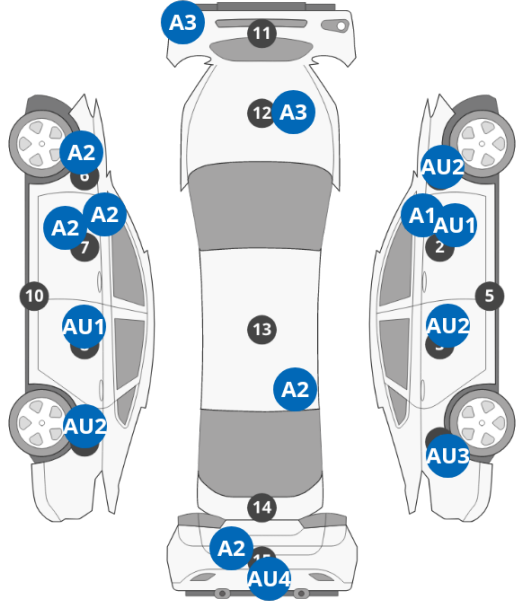
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	108	111	107
2	Boot Lid	108.3	112	102	111
3	Roof	91.4	101	90	86/89
4	Left Front Fender	96.0	97	97	95
5	Left Front Door	172.3	152	145	220
6	Center Panel Left				
7	Left Rear Door	211.0	321	191	121
8	Left Back Panel	103.1	111	97	101
9	Right Front Fender	94.5	97	96	91
10	Right Front Door	97.8	106	95	93
11	Center Panel Right				
12	Right Rear Door	96.7	91	97	102
13	Right Back Panel	95.6	99	92	96

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	D
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Medium / Dashboard - Loose, Deformed - Medium / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Seat Head Rest - Missing - Yes / Rear Seat Head Rest - Missing - Yes / (L) Front Seat Head Rest - Missing - Yes</p>		<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small</p>	
Frame Evaluation :	A	Functional Evaluation :	C
<p>Remarks Defects not found</p>		<p>Remarks Warning Lamps - Issue - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
No Lto plate, no warranty booklet, no spare tire, no jack and tools, issue on 1key, issue on radio, warning lamp on