

General Information

Date & Time: 19, Jan, 2026 08:32

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	22,426
Registration No.	NHM3733	Chassis No.	MHFAB1Y9P3072173
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



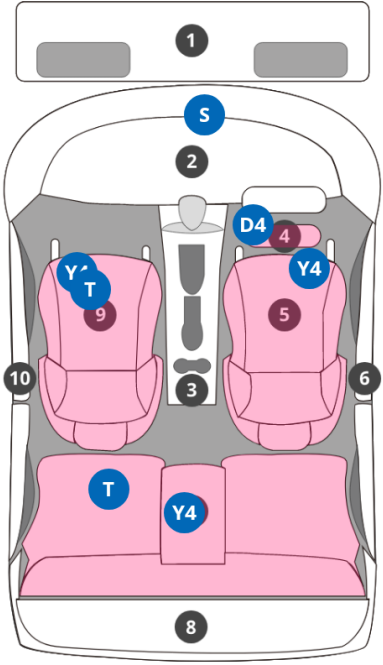
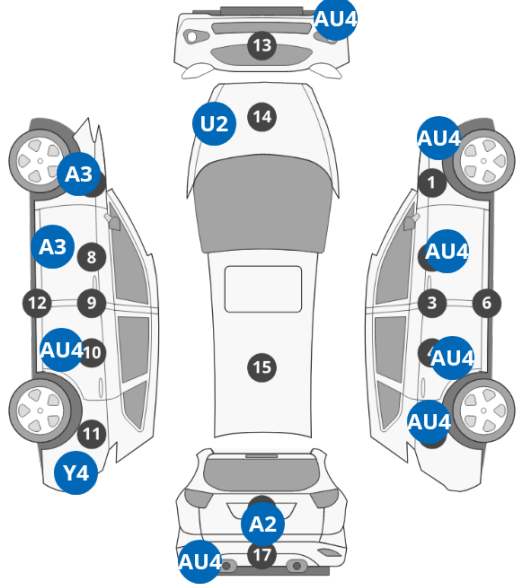
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	103	111	115
2	Boot Lid	97.5	94	102	97
3	Roof	114.0	122	120	106/108
4	Left Front Fender	95.9	94	96	98
5	Left Front Door	119.0	115	119	123
6	Center Panel Left				
7	Left Rear Door	109.6	108	106	115
8	Left Back Panel	105.0	112	105	98
9	Right Front Fender	99.0	101	98	98
10	Right Front Door	115.6	121	116	110
11	Center Panel Right				
12	Right Rear Door	111.3	114	107	113
13	Right Back Panel	104.0	101	100	111

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Large / (L) Front Seat - Cigarette Burns - Burnt, Hole / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Rear Seat - Cigarette Burns - Burnt, Hole / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Crack, Gap - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no jack and tools/ no LTO plate/ with spare tire and warranty booklet/</p>