

General Information

Date & Time: 15, Jan, 2026 05:49

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	69,578
Registration No.	FAR9886	Chassis No.	MHFAA1BY2R0026661
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	White		

Body / Panel Condition



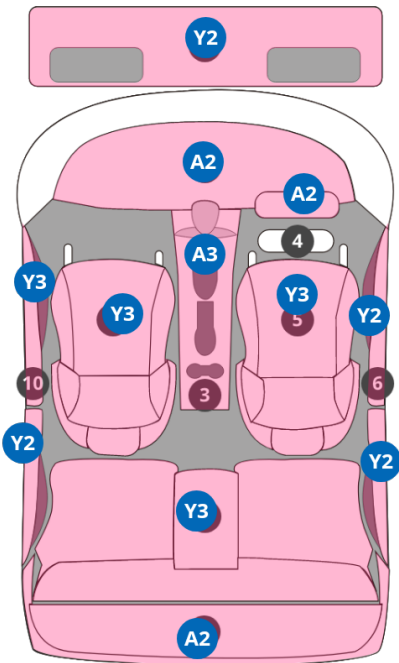
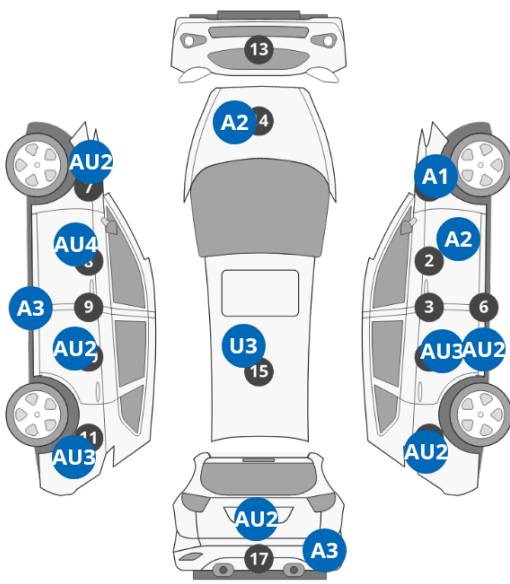
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.4	101	83	91
2	Boot Lid	77.8	75	85	74
3	Roof	85.7	86	84	88/85
4	Left Front Fender	82.4	83	84	80
5	Left Front Door	88.9	84	85	99
6	Center Panel Left				
7	Left Rear Door	92.4	92	92	94
8	Left Back Panel	95.2	97	94	94
9	Right Front Fender	89.4	93	91	84
10	Right Front Door	88.3	94	85	86
11	Center Panel Right				
12	Right Rear Door	89.0	95	85	88
13	Right Back Panel	86.6	87	80	93

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/No warranty booklet/with jack No tools/No reverse camera/No fog light/roof traces of adhesive tape/with seat cover</p>