

General Information

Date & Time: 15, Jan, 2026 08:47

Make	Ford	Model	Everest
YOM	2018	Odo Meter Reading	72,017
Registration No.	NBK2622	Chassis No.	MNCAXXMAWAHD57512
CC	3.2	Transmission	A/T
Fuel Type	Diesel	Type of Body	Sport Utility
Colour	Black		

Body / Panel Condition



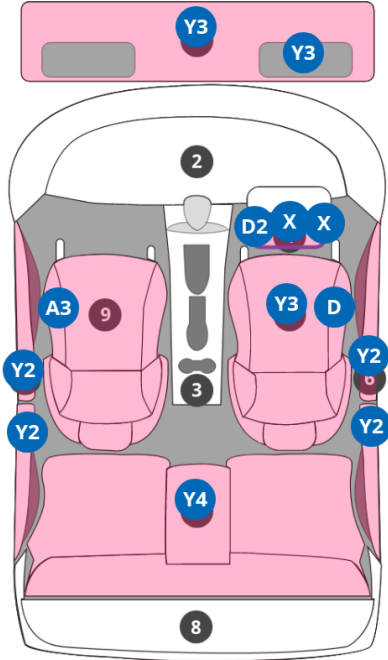
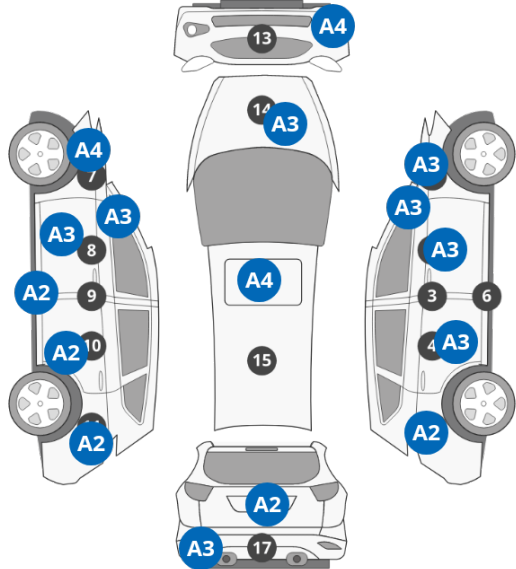
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	173.0	166	180	173
2	Boot Lid	139.6	146	135	138
3	Roof	113.0	117	114	108/113
4	Left Front Fender	186.0	284	139	135
5	Left Front Door	128.6	126	120	140
6	Center Panel Left				
7	Left Rear Door	177.6	193	160	180
8	Left Back Panel	144.6	163	136	135
9	Right Front Fender	155.6	139	182	146
10	Right Front Door	258.3	210	371	194
11	Center Panel Right				
12	Right Rear Door	137.3	131	122	159
13	Right Back Panel	161.0	162	147	174

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cut, Crack - Medium / (L) Front Trim - Grime - Small / Mat Other - Missing - Yes / (L) Front Floor Mat - Worked - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Large / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Repair Mark - Yes / (R) Front Seat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Large / (L) Mirror - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / Overall Exterior - Faded(Color, Gloss) - Yes / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Large</p>
Frame Evaluation : C	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Front seat side trim issue both side. Power window switch front right switch and master switch issue. Seats has molds. Without warranty booklet and tools. With spare tire and jack. 1 key. With LTO plate.</p>