

General Information

Date & Time: 13, Jan, 2026 18:40

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	262,767
Registration No.	GAW4123-1	Chassis No.	JTFNAFAP9M8022868
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Black		

Body / Panel Condition



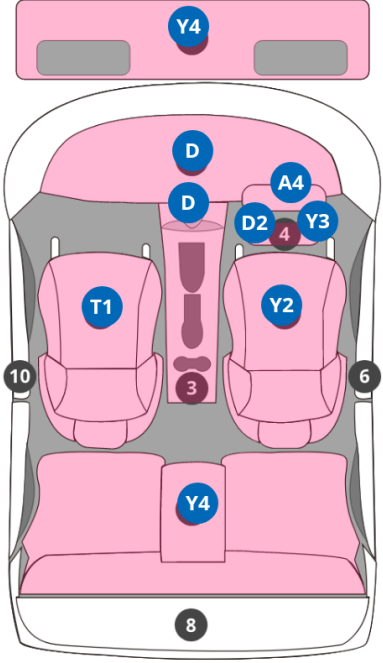
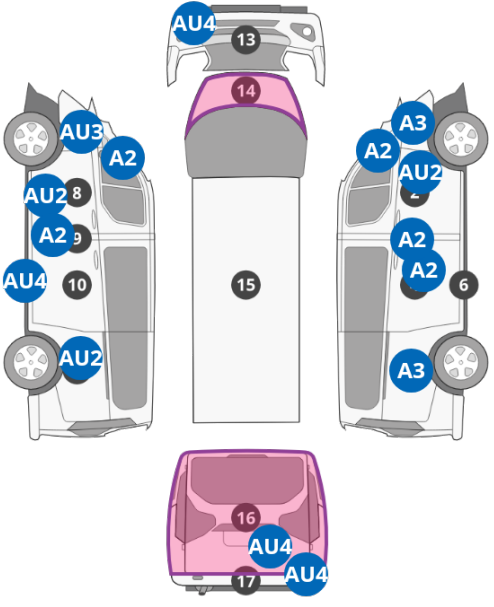
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	136	119	126
2	Boot Lid	152.0	135	136	185
3	Roof	118.7	94	97	143/141
4	Left Front Fender	156.6	165	153	152
5	Left Front Door	146.0	142	137	159
6	Center Panel Left	192.0	159	211	206
7	Left Rear Door				
8	Left Back Panel	153.6	156	145	160
9	Right Front Fender	140.6	146	139	137
10	Right Front Door	137.6	131	131	151
11	Center Panel Right	148.6	140	165	141
12	Right Rear Door	152.6	164	138	156
13	Right Back Panel	136.3	124	142	143

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Large / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Large / (L) Front Seat - Cigarette Burns - Burnt Minimal</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Center Panel - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / Trunk Hood, Rear Gate - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

Possible flooding. Battery for replacement. Engine oil for replacement. Crack left tail light. Gap at front bumper. With warranty booklet, and spare tire. Without jack, tools and seat cover. 1 key. With LTO plate.