

General Information

Date & Time: 16, Jan, 2026 10:34

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	249,879
Registration No.	DAY1611	Chassis No.	MR0JB8DDL3174333
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Red		

Body / Panel Condition



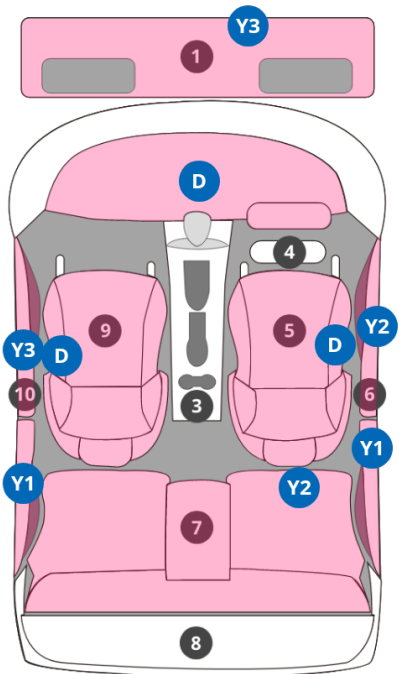
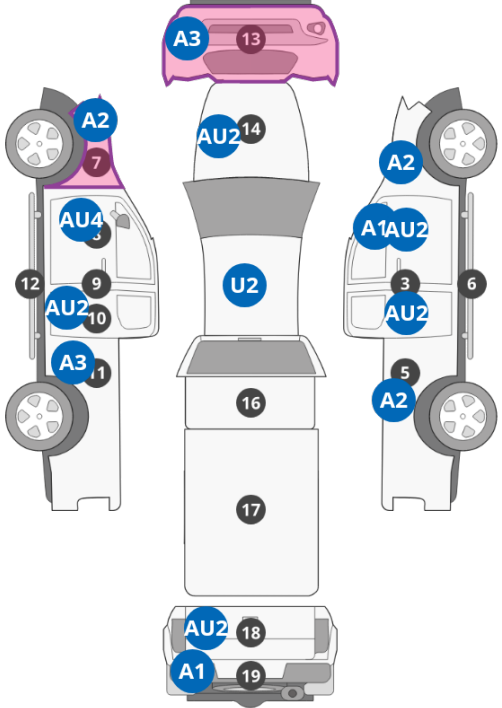
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.6	113	131	124
2	Boot Lid	107.0	103	101	117
3	Roof	116.3	142	115	110/98
4	Left Front Fender	283.3	435	211	204
5	Left Front Door	109.3	112	116	100
6	Center Panel Left				
7	Left Rear Door	106.0	110	108	100
8	Left Back Panel	105.0	104	95	116
9	Right Front Fender	105.7	110	99	108
10	Right Front Door	105.9	101	118	99
11	Center Panel Right				
12	Right Rear Door	99.1	100	97	101
13	Right Back Panel	106.6	112	101	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes / (L) Front Seat - Worn - Yes / Ceiling - Grime - Medium / (R) Front Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Crack - Cracks / (R) Mirror - Scratch - Minimal / (R) Side Gate - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Overall Exterior - Worn as per age - Yes / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with Warranty Booklet, No Jack, Incomplete Tools, with Sparetire and LTO Plate, Scratches on headlight and Tail Light, cracked Tail Light, fog lamp issue, traction control indicator on, rearseat stuck up</p>