

General Information

Date & Time: 15, Jan, 2026 14:01

Make	Toyota	Model	Vios
YOM	2011	Odo Meter Reading	177,541
Registration No.	PQM857	Chassis No.	NCP920374092
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Beige		

Body / Panel Condition



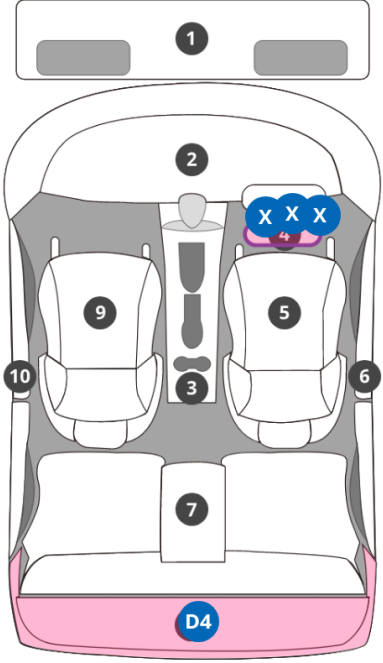
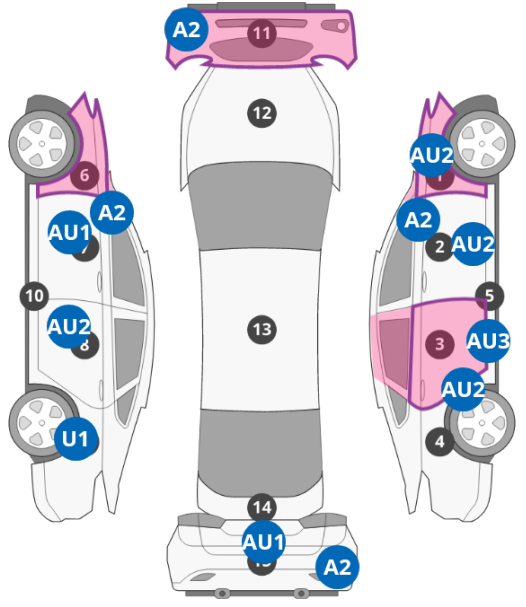
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	93	120	109
2	Boot Lid	92.4	94	83	100
3	Roof	100.9	99	110	97/98
4	Left Front Fender	225.6	226	246	205
5	Left Front Door	100.1	100	98	103
6	Center Panel Left				
7	Left Rear Door	102.8	108	102	99
8	Left Back Panel	103.8	108	104	100
9	Right Front Fender	166.0	107	133	258
10	Right Front Door	111.6	117	116	102
11	Center Panel Right				
12	Right Rear Door	200.3	186	212	203
13	Right Back Panel	117.0	124	112	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Trunk Room - Loose, Deformed - Large	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, no warranty booklet, 1key, with spare tire, no jack and tools, battery weak, scratches on headlights and taillights, trunk cover missing