

General Information

Date & Time: 16, Jan, 2026 10:15

Make	Toyota	Model	Vios
YOM	2009	Odo Meter Reading	125,175
Registration No.	NPO658	Chassis No.	NCP929016571
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



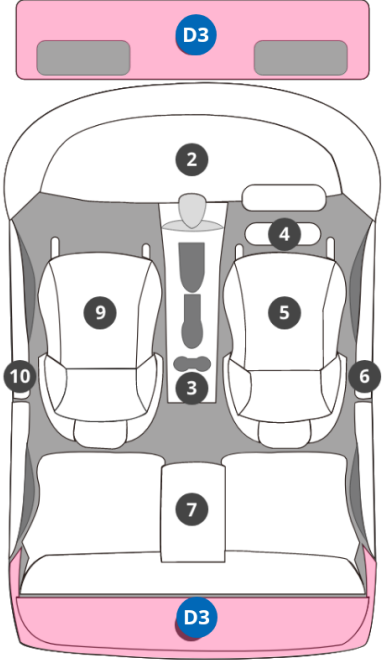
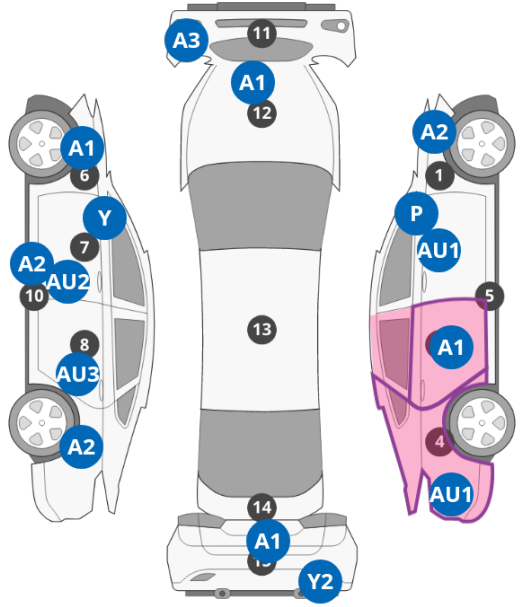
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	103	95	103
2	Boot Lid	139.0	113	185	119
3	Roof	107.2	112	108	101/108
4	Left Front Fender	138.6	145	135	136
5	Left Front Door	118.3	120	115	120
6	Center Panel Left				
7	Left Rear Door	130.6	128	136	128
8	Left Back Panel	136.6	134	140	136
9	Right Front Fender	130.3	136	133	122
10	Right Front Door	128.0	132	124	128
11	Center Panel Right				
12	Right Rear Door	220.0	215	241	204
13	Right Back Panel	539.0	285	853	479

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Loose, Deformed - Medium / Trunk Room - Loose, Deformed - Medium	Remarks Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Crack - Cracks / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet, no tools, scratches on headlights and taillights, faded bumper ,cover under bonet missing, trunk room cover missing,