

General Information

Date & Time: 16, Jan, 2026 12:36

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,266
Registration No.	CCQ3236	Chassis No.	PA1B18F35S4292394
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



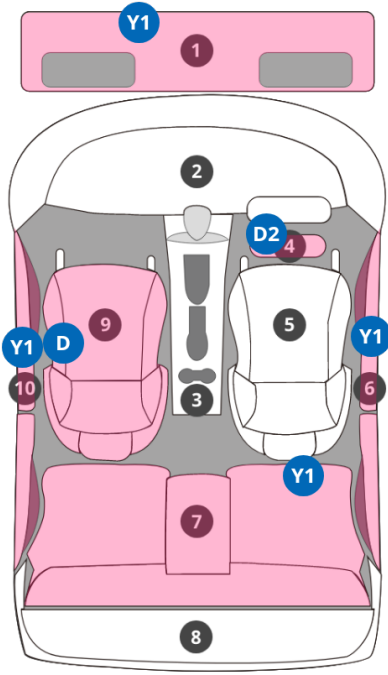
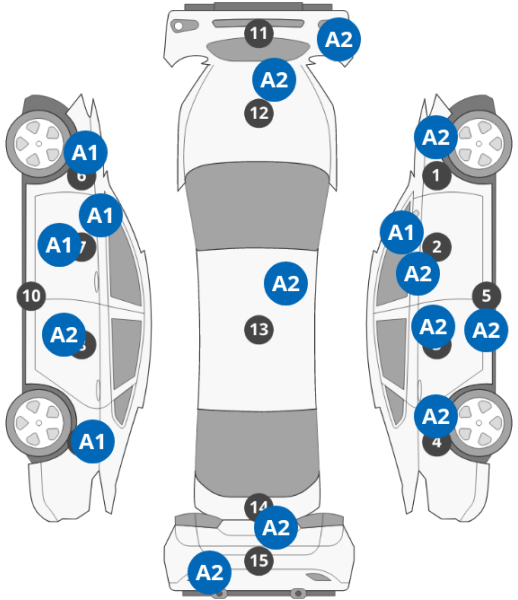
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	112	116	117
2	Boot Lid	107.0	109	104	108
3	Roof	100.4	106	98	95/102
4	Left Front Fender	102.2	103	106	98
5	Left Front Door	107.6	107	108	108
6	Center Panel Left				
7	Left Rear Door	104.4	112	105	96
8	Left Back Panel	110.3	119	109	103
9	Right Front Fender	96.5	93	95	102
10	Right Front Door	96.3	91	100	99
11	Center Panel Right				
12	Right Rear Door	95.1	98	93	94
13	Right Back Panel	102.8	99	101	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with Warranty Booklet, Jack, and Tools, with Spare tire and LTO Plate, Scratches on Tail light</p>