

General Information

Date & Time: 16, Jan, 2026 14:11

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	25,984
Registration No.	CCG4369	Chassis No.	PA1B18F34R4270669
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



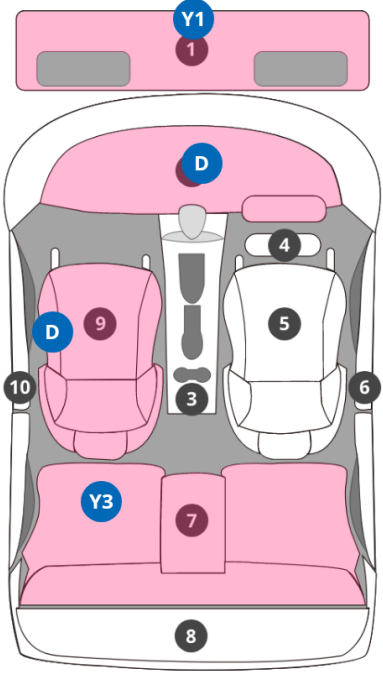
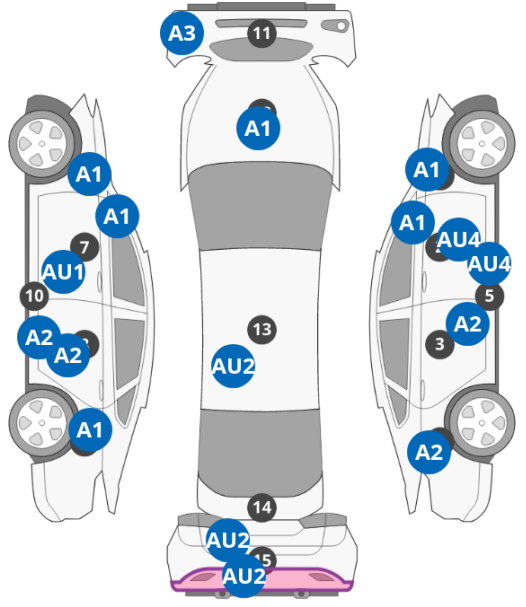
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	101	109	108
2	Boot Lid	113.6	117	107	117
3	Roof	95.3	101	95	95/90
4	Left Front Fender	99.8	100	101	99
5	Left Front Door	101.0	105	95	103
6	Center Panel Left				
7	Left Rear Door	106.9	119	102	100
8	Left Back Panel	117.0	110	117	124
9	Right Front Fender	102.7	101	109	98
10	Right Front Door	95.6	95	95	97
11	Center Panel Right				
12	Right Rear Door	96.3	94	94	101
13	Right Back Panel	103.6	107	98	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	D
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Seat - Worn - Yes / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / Rear Seat - Grime - Medium</p>		<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Spare Key - Issue - Unexist</p>	

Inspector Notes
<p>no warranty Booklet, with Jack and Tools, with Sparetire and LTO Plate, Scratches on Tail light</p>