

General Information

Date & Time: 16, Jan, 2026 15:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	60,866
Registration No.	NKI9656	Chassis No.	PA1B18F30R4261365
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



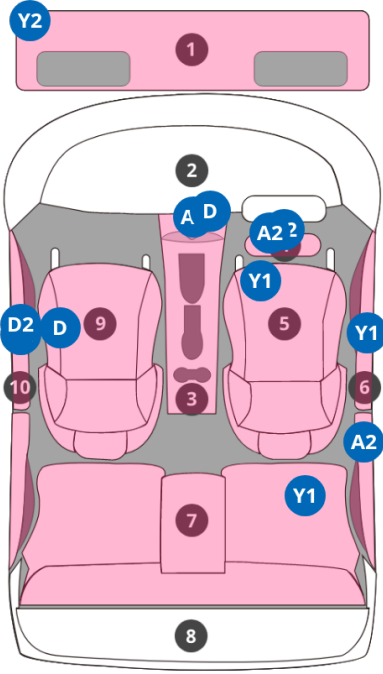
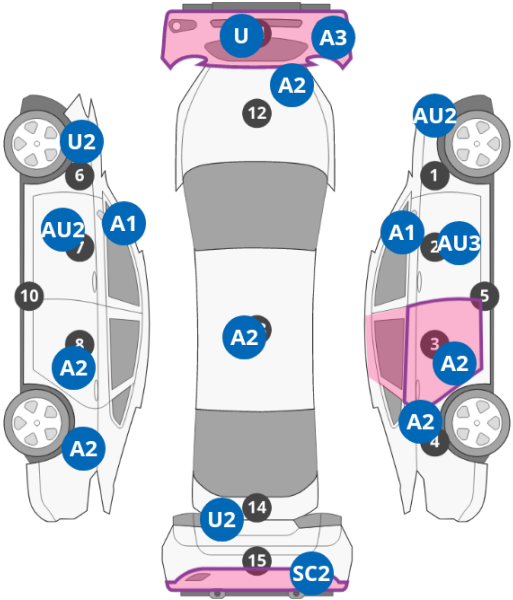
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	129	108	110
2	Boot Lid	118.6	113	110	133
3	Roof	98.7	105	99	95/96
4	Left Front Fender	299.0	170	586	141
5	Left Front Door	104.7	108	107	99
6	Center Panel Left				
7	Left Rear Door	110.3	121	100	110
8	Left Back Panel	106.3	108	106	105
9	Right Front Fender	163.6	165	163	163
10	Right Front Door	102.5	107	102	99
11	Center Panel Right				
12	Right Rear Door	104.3	106	104	103
13	Right Back Panel	107.0	102	100	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Cut, Crack - Small / (R) Rear Trim - Cut, Crack - Small / Rear Seat - Grime - Minimal / Ceiling - Grime - Small / (R) Front Seat - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty Booklet, with Jack, Incomplete Tools, with Sparetire and LTO Plate, Scratches on Tail light, left cheek light loose</p>