

General Information

Date & Time: 19, Jan, 2026 19:05

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	9,621
Registration No.	DCA5891	Chassis No.	MHKAA1BC1RJ030698
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



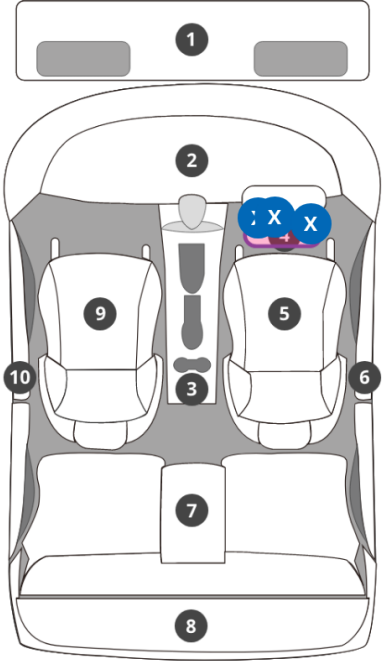
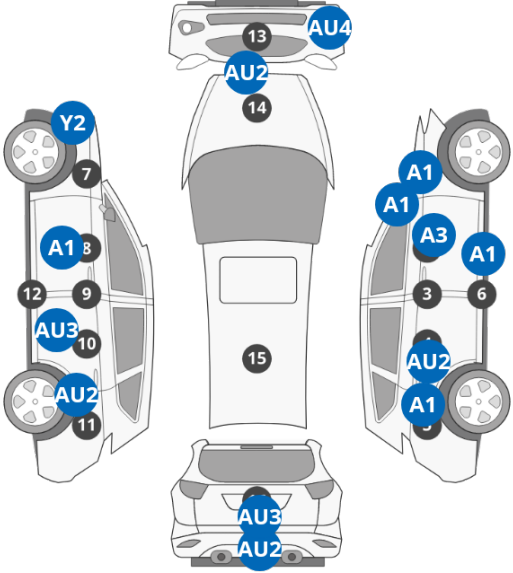
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	123	119	106
2	Boot Lid	93.1	100	89	90
3	Roof	80.6	81	76	83/83
4	Left Front Fender	98.0	97	93	104
5	Left Front Door	111.0	108	107	118
6	Center Panel Left				
7	Left Rear Door	107.5	114	99	110
8	Left Back Panel	97.3	100	95	97
9	Right Front Fender	98.1	115	92	88
10	Right Front Door	114.0	128	108	106
11	Center Panel Right				
12	Right Rear Door	104.6	98	94	122
13	Right Back Panel	89.5	93	86	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Crack, Gap - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, Crack headlight and fog light,scratches on taillights</p>