

General Information

Date & Time: 16, Jan, 2026 14:11

Make	Toyota	Model	Yaris Cross
YOM	2024	Odo Meter Reading	37,830
Registration No.	IAF3347	Chassis No.	MHFAABAF6P0017449
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



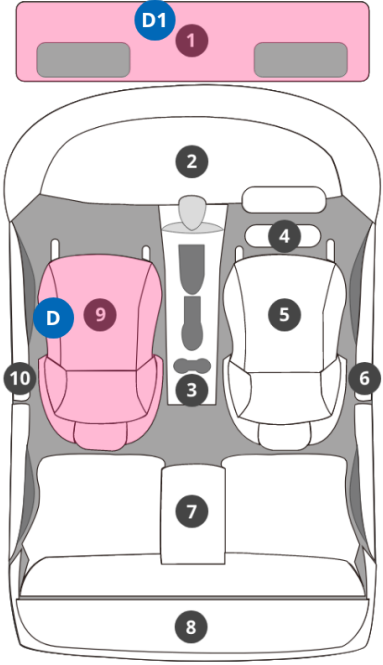
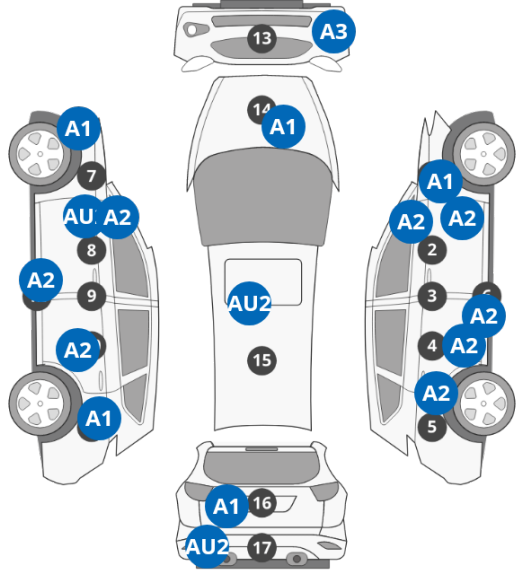
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	169.3	170	178	160
2	Boot Lid	107.0	99	110	112
3	Roof	135.7	131	142	134/136
4	Left Front Fender	210.3	213	219	199
5	Left Front Door	123.0	117	127	125
6	Center Panel Left				
7	Left Rear Door	116.6	115	115	120
8	Left Back Panel	139.0	142	134	141
9	Right Front Fender	119.0	120	118	119
10	Right Front Door	129.0	129	130	128
11	Center Panel Right				
12	Right Rear Door	121.0	127	119	117
13	Right Back Panel	129.3	133	125	130

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Worn - Yes / Ceiling - Crinkle - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, ni jack, incomplete tools, No Sparetire and LTO Plate, Scratches on Tail light