

General Information

Date & Time: 16, Jan, 2026 15:53

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	29,686
Registration No.	NIH9936	Chassis No.	MHKADF3FLJ73M462
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Orange		

Body / Panel Condition



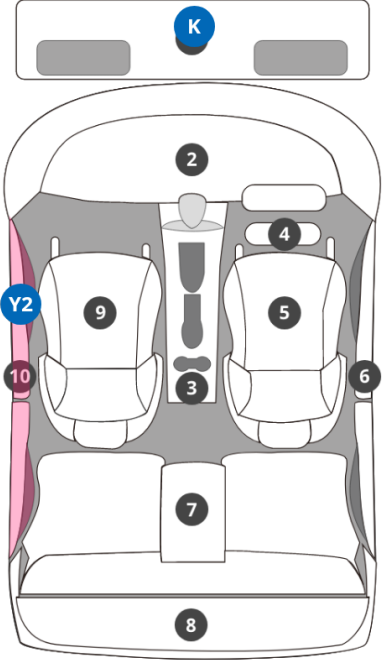
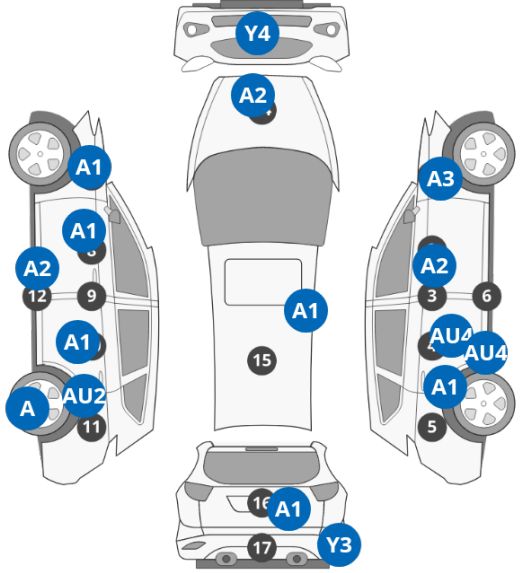
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.7	97	90	100
2	Boot Lid	99.9	99	103	98
3	Roof	87.2	83	95	87/84
4	Left Front Fender	95.2	92	95	99
5	Left Front Door	100.7	105	100	97
6	Center Panel Left				
7	Left Rear Door	98.2	99	96	100
8	Left Back Panel	95.9	101	91	96
9	Right Front Fender	103.8	110	105	97
10	Right Front Door	103.3	102	107	101
11	Center Panel Right				
12	Right Rear Door	104.6	100	107	107
13	Right Back Panel	98.7	97	99	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Trim - Grime - Small / Overall Interior - Animal Hair - Yes	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / (L) Rear Tyre - Crack, Cut - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlights and taillights