

General Information

Date & Time: 20, Jan, 2026 16:09

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,795
Registration No.	NHM6629	Chassis No.	PA1B18F33R4243138
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



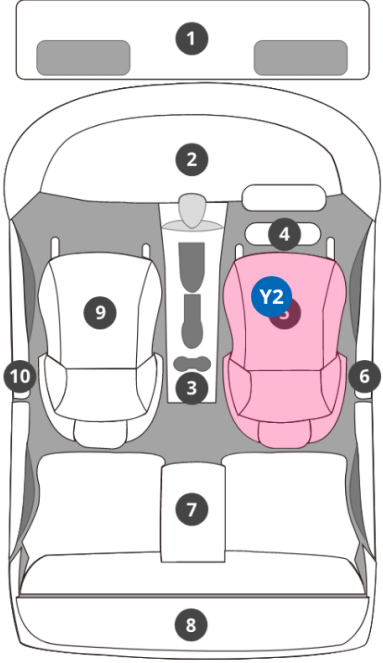
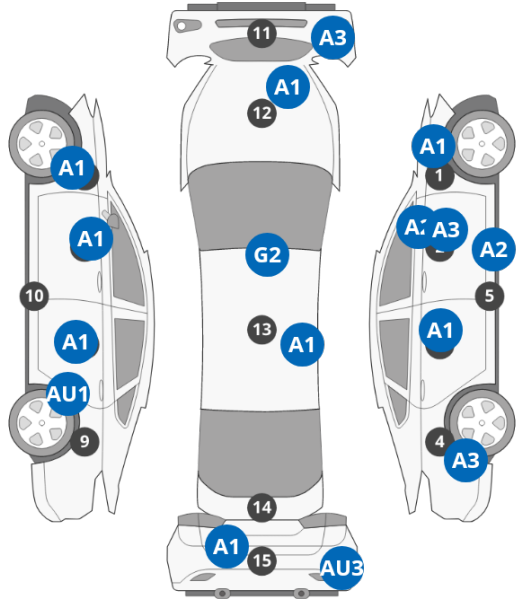
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	125	107	102
2	Boot Lid	112.0	110	107	119
3	Roof	92.9	94	92	90/95
4	Left Front Fender	100.6	100	100	102
5	Left Front Door	99.1	99	99	99
6	Center Panel Left				
7	Left Rear Door	107.3	116	106	100
8	Left Back Panel	107.0	114	106	101
9	Right Front Fender	104.6	110	102	102
10	Right Front Door	104.0	101	106	105
11	Center Panel Right				
12	Right Rear Door	107.0	102	106	113
13	Right Back Panel	109.3	107	107	114

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights