

General Information

Date & Time: 21, Jan, 2026 11:26

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	43,366
Registration No.	NFK3504	Chassis No.	PA1B18F32N4175084
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



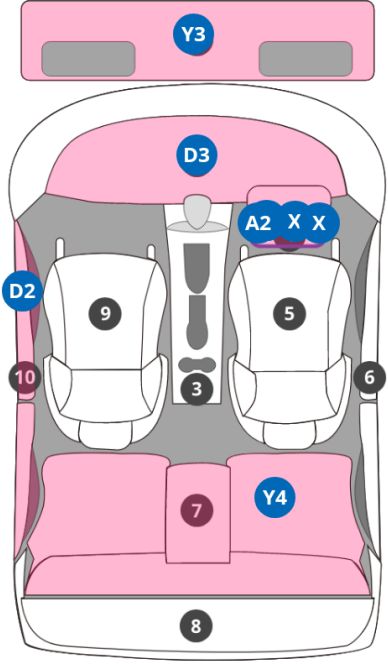
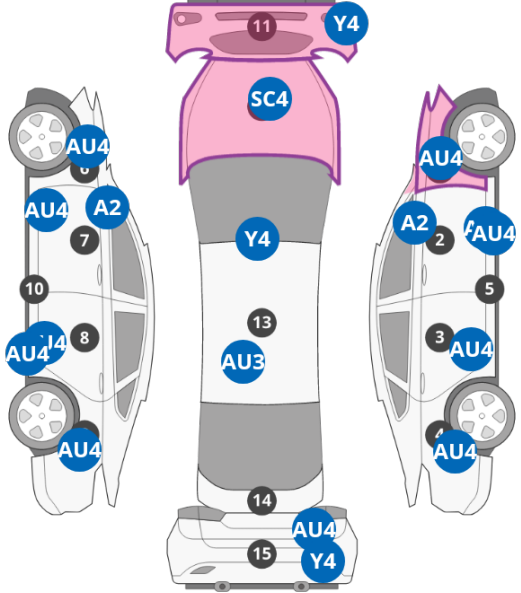
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	229.3	222	233	233
2	Boot Lid	228.6	267	204	215
3	Roof	92.3	98	90	88/94
4	Left Front Fender	151.6	165	165	125
5	Left Front Door	99.6	97	100	102
6	Center Panel Left				
7	Left Rear Door	107.3	109	106	107
8	Left Back Panel	131.0	148	114	131
9	Right Front Fender	596.3	310	876	603
10	Right Front Door	100.2	104	102	95
11	Center Panel Right				
12	Right Rear Door	97.3	96	96	100
13	Right Back Panel	136.0	141	134	133

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / Rear Seat - Grime - Large / (L) Front Trim - Loose, Deformed - Small / Glove Box - Loose, Deformed - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch & Dent - Large / Front Windshield - Damaged - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Rust, Corrosion - Large</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, 1key, no spare tire, no warranty booklet, no jack and tools, foul smell, Crack head lights and taillights,</p>