

General Information

Date & Time: 21, Jan, 2026 11:24

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,190
Registration No.	CCG8724	Chassis No.	PA1B18F39S4286775
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



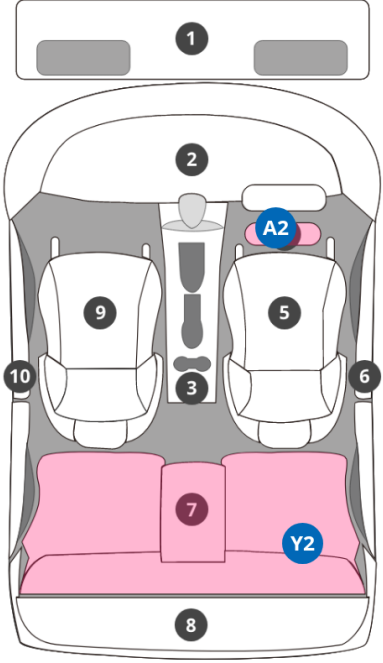
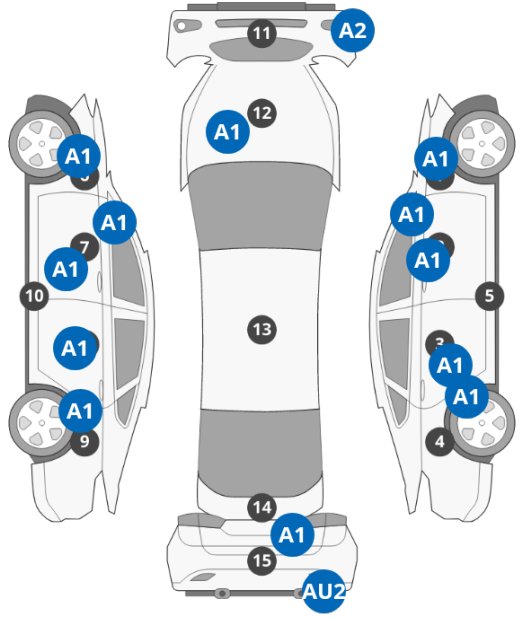
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	117	105	111
2	Boot Lid	106.0	109	94	115
3	Roof	97.8	98	105	92/97
4	Left Front Fender	97.0	100	96	95
5	Left Front Door	98.0	99	94	101
6	Center Panel Left				
7	Left Rear Door	101.2	103	102	99
8	Left Back Panel	99.4	97	100	102
9	Right Front Fender	112.0	107	101	128
10	Right Front Door	103.1	110	96	103
11	Center Panel Right				
12	Right Rear Door	107.3	109	103	110
13	Right Back Panel	103.4	98	104	108

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes</p>

<p>Inspector Notes</p>
<p>With Lto plate,with warranty booklet, with tools, 3keys, no spare tire and jack, traces of adhesive on headlights and taillights, headlights issue</p>