

General Information

Date & Time: 22, Jan, 2026 15:44

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	70,380
Registration No.	NHR1937	Chassis No.	PA1B18F33P4225798
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



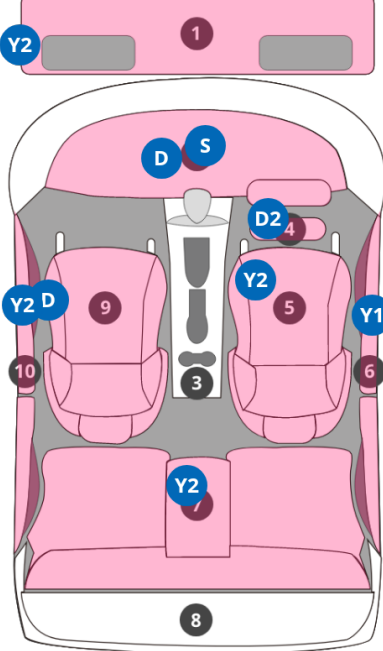
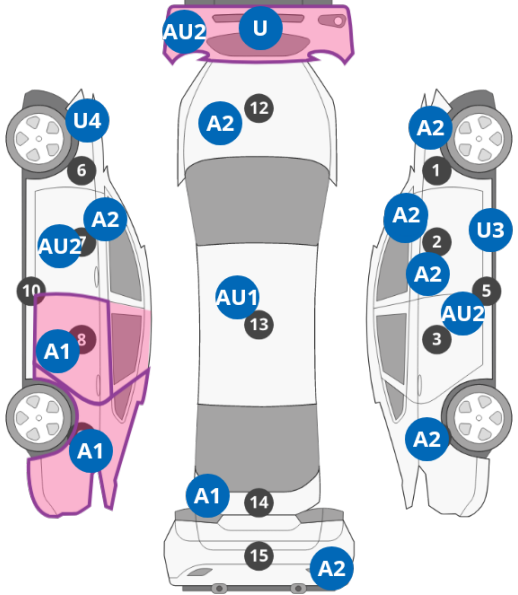
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	190.6	150	158	264
2	Boot Lid	106.3	108	101	110
3	Roof	107.6	104	105	98/124
4	Left Front Fender	253.6	312	325	124
5	Left Front Door	100.5	108	96	98
6	Center Panel Left				
7	Left Rear Door	127.6	126	116	141
8	Left Back Panel	113.6	127	110	104
9	Right Front Fender	172.6	150	192	176
10	Right Front Door	102.8	111	100	98
11	Center Panel Right				
12	Right Rear Door	99.3	95	98	106
13	Right Back Panel	105.6	102	99	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Large / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Minimal</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare, with LTO plate, possible flooding, scratches on tail light</p>