

General Information

Date & Time: 23, Jan, 2026 13:58

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	88,808
Registration No.	NEF5576	Chassis No.	PA1B18F30L4111607
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



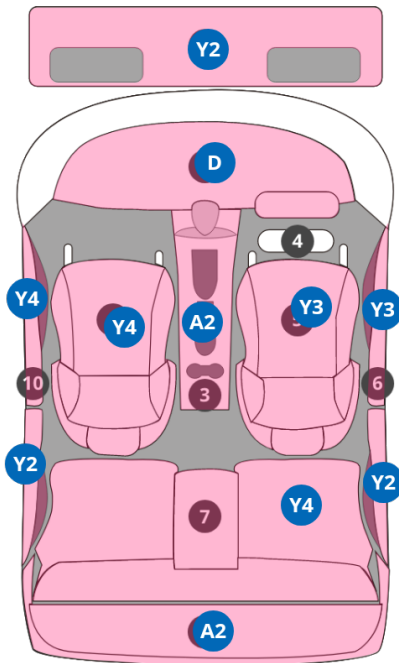
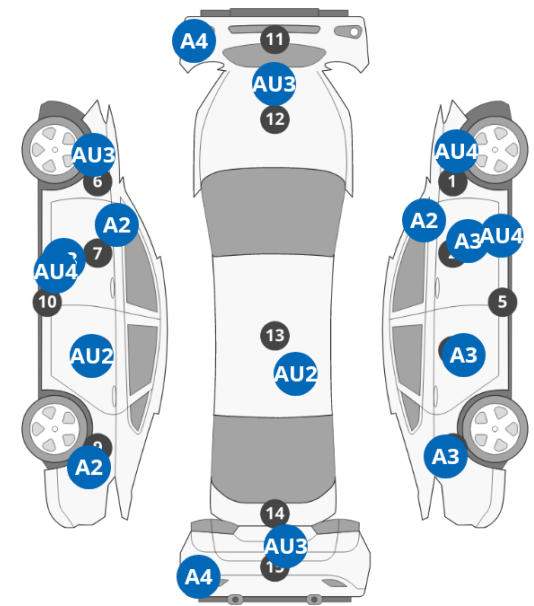
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.3	105	89	101
2	Boot Lid	95.2	93	93	100
3	Roof	80.1	91	73	79/77
4	Left Front Fender	82.9	84	82	84
5	Left Front Door	94.0	94	96	93
6	Center Panel Left				
7	Left Rear Door	91.7	99	89	87
8	Left Back Panel	98.0	106	91	98
9	Right Front Fender	81.1	90	76	78
10	Right Front Door	86.6	84	86	90
11	Center Panel Right				
12	Right Rear Door	253.6	343	262	156
13	Right Back Panel	405.0	244	190	781

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and incomplete tools/aircon issue/plate light issue/No reverse camera/with warranty booklet/No seat cover/interior dirty/head unit issue/left side rear tail light cover medium crack