

General Information

Date & Time: 20, Jan, 2026 15:20

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	40,108
Registration No.	DBO4299	Chassis No.	PA1B18F36P4236813
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



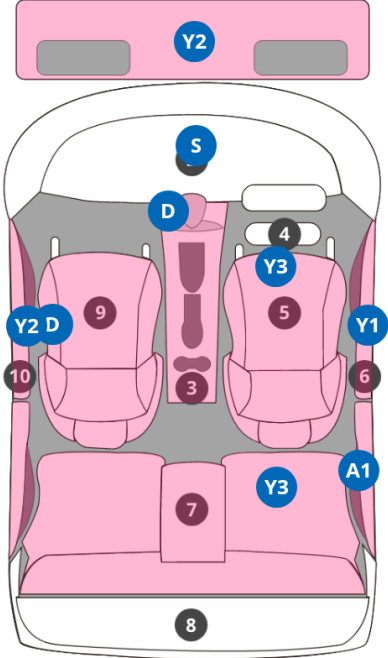
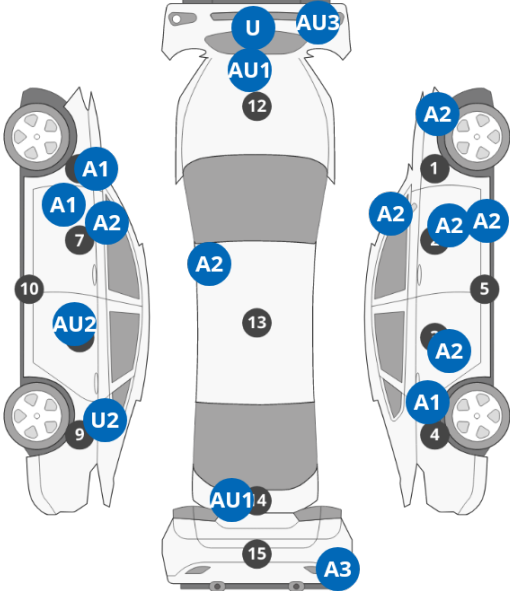
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	100	112	142
2	Boot Lid	111.3	114	114	106
3	Roof	100.9	105	106	98/95
4	Left Front Fender	98.8	99	99	99
5	Left Front Door	102.2	102	97	108
6	Center Panel Left				
7	Left Rear Door	105.3	109	104	103
8	Left Back Panel	114.0	123	122	97
9	Right Front Fender	104.3	101	108	104
10	Right Front Door	99.3	96	103	99
11	Center Panel Right				
12	Right Rear Door	108.0	101	114	109
13	Right Back Panel	104.3	104	104	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, possible flooding, scratches on tail light, right side mirror issue</p>