

General Information

Date & Time: 20, Jan, 2026 09:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,720
Registration No.	DBQ7296	Chassis No.	PA1B18F37R4270794
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



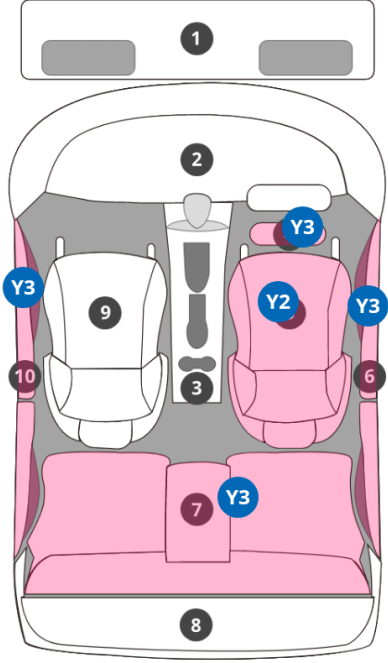
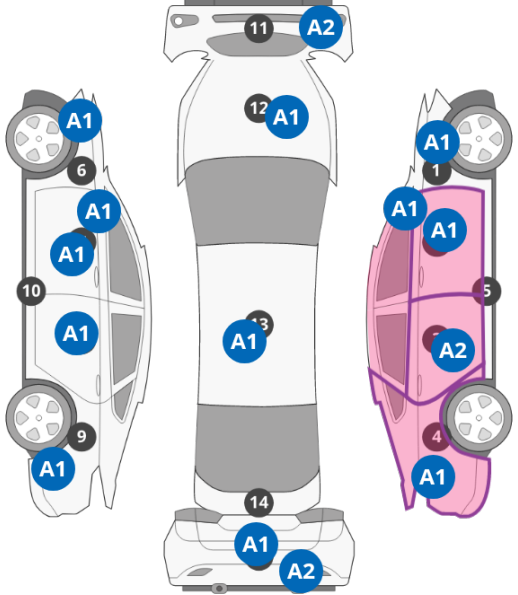
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.8	114	100	110
2	Boot Lid	109.3	105	115	108
3	Roof	89.2	101	87	86/83
4	Left Front Fender	94.5	93	95	96
5	Left Front Door	94.1	92	91	99
6	Center Panel Left				
7	Left Rear Door	100.1	105	97	98
8	Left Back Panel	108.6	114	109	103
9	Right Front Fender	101.3	104	97	103
10	Right Front Door	173.0	162	163	194
11	Center Panel Right				
12	Right Rear Door	250.3	255	259	237
13	Right Back Panel	306.6	203	238	479

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack No tools/with reverse camera/with warranty booklet/No seat cover</p>