

General Information

Date & Time: 22, Jan, 2026 07:39

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	18,758
Registration No.	DBQ7900	Chassis No.	MHFAA1BY7R0032181
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



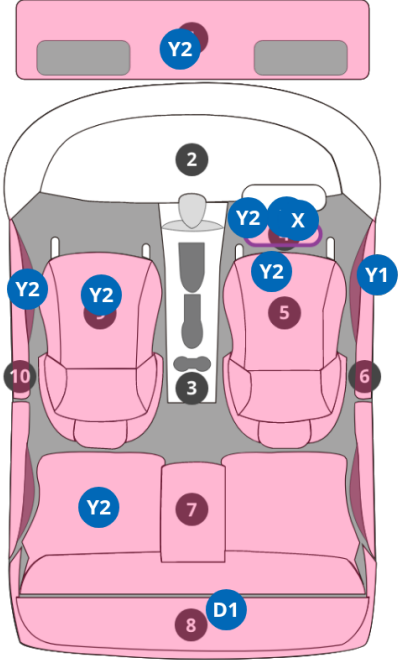
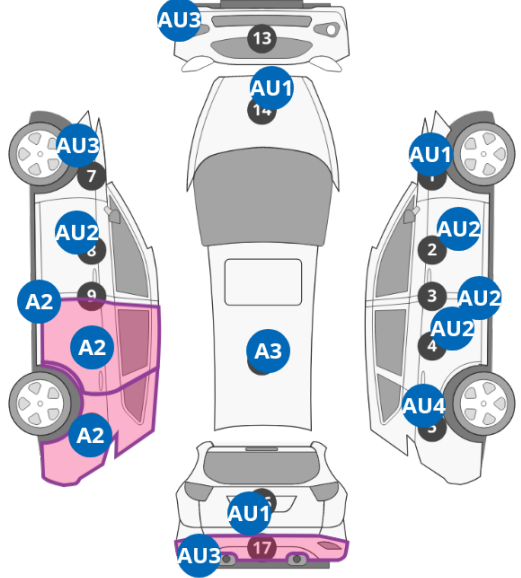
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	119	107	103
2	Boot Lid	107.6	109	102	112
3	Roof	122.7	124	142	114/111
4	Left Front Fender	110.3	121	104	106
5	Left Front Door	119.6	108	125	126
6	Center Panel Left				
7	Left Rear Door	188.6	164	160	242
8	Left Back Panel	462.0	995	186	205
9	Right Front Fender	110.0	109	110	111
10	Right Front Door	114.6	118	119	107
11	Center Panel Right				
12	Right Rear Door	114.6	118	111	115
13	Right Back Panel	122.6	124	102	142

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Trunk Room - Worked - Minimal	Remarks (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate, with spare tire, with warranty booklet, with spare key, with jack, scratches on taillight and headlight, issue on foglamps.