

General Information

Date & Time: 21, Jan, 2026 11:03

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	24,104
Registration No.	DBT2147	Chassis No.	MHKAA1BC1RJ034136
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



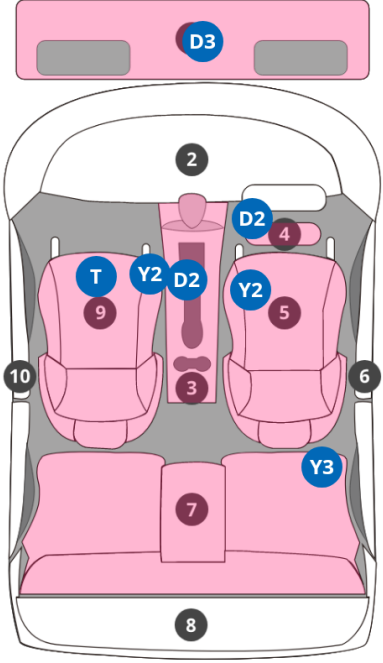
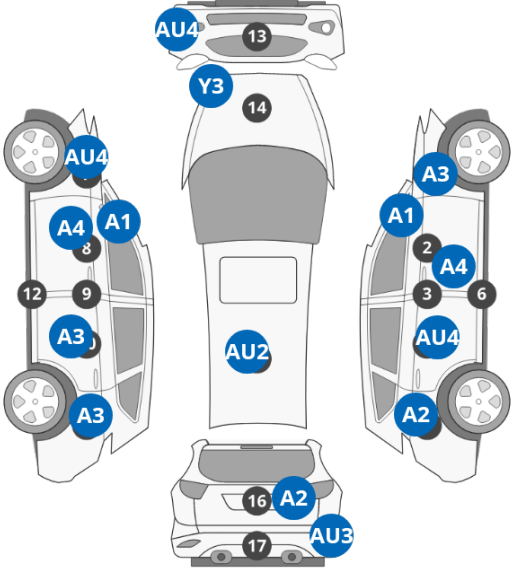
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	119	121	122
2	Boot Lid	89.7	89	93	87
3	Roof	82.9	86	76	89/81
4	Left Front Fender	108.6	112	104	110
5	Left Front Door	114.0	115	117	110
6	Center Panel Left				
7	Left Rear Door	103.2	110	105	95
8	Left Back Panel	101.7	100	98	107
9	Right Front Fender	101.3	95	117	92
10	Right Front Door	115.0	126	105	114
11	Center Panel Right				
12	Right Rear Door	103.9	97	107	108
13	Right Back Panel	103.7	114	105	92

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cigarette Burns - Burnt, Hole / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Crinkle - Medium / Rear Seat - Grime - Medium / Console, Switches, Vents - Loose, Deformed - Small</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, left front fender liner missing</p>