

General Information

Date & Time: 17, Jan, 2026 14:07

Make	Honda	Model	City
YOM	2019	Odo Meter Reading	44,193
Registration No.	NBS2242	Chassis No.	PADGM6620KV517295
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



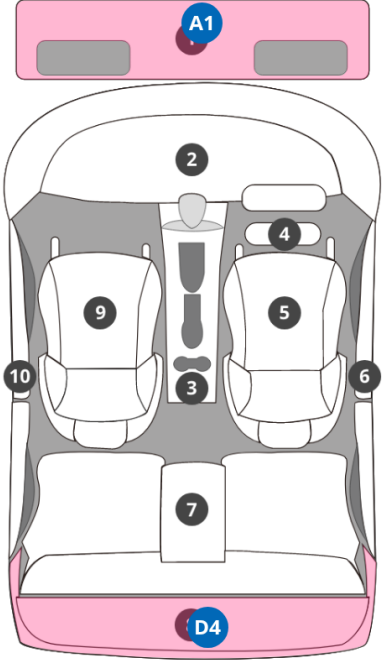
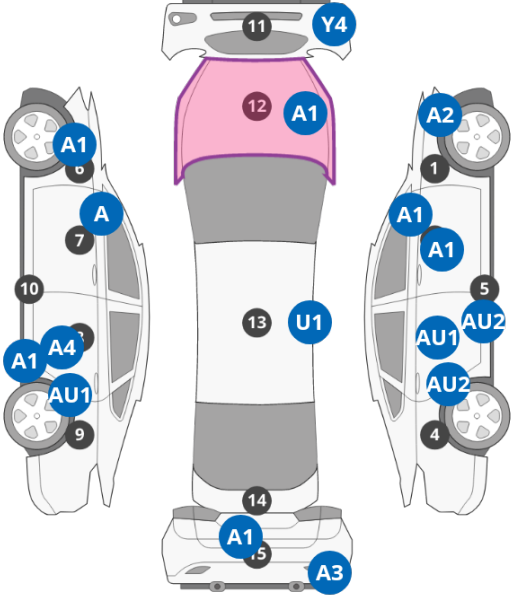
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.5	107	122	88
2	Boot Lid	84.9	97	72	86
3	Roof	82.2	89	82	78/80
4	Left Front Fender	69.8	67	67	75
5	Left Front Door	82.0	89	72	86
6	Center Panel Left				
7	Left Rear Door	137.6	150	134	129
8	Left Back Panel	88.3	99	82	85
9	Right Front Fender	74.1	82	72	69
10	Right Front Door	81.2	79	75	91
11	Center Panel Right				
12	Right Rear Door	85.8	91	75	91
13	Right Back Panel	84.8	78	81	96

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Cut, Crack - Minimal / Trunk Room - Loose, Deformed - Large</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch, Peeled - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Roof - Dent - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, 1key, no jack and tools, no warranty booklet, scratches on headlights and taillights, no trunk cover</p>