

General Information

Date & Time: 19, Jan, 2026 09:31

Make	Toyota	Model	Avanza
YOM	2016	Odo Meter Reading	87,363
Registration No.	NDS2278	Chassis No.	MHKM5FF3FGK000911
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



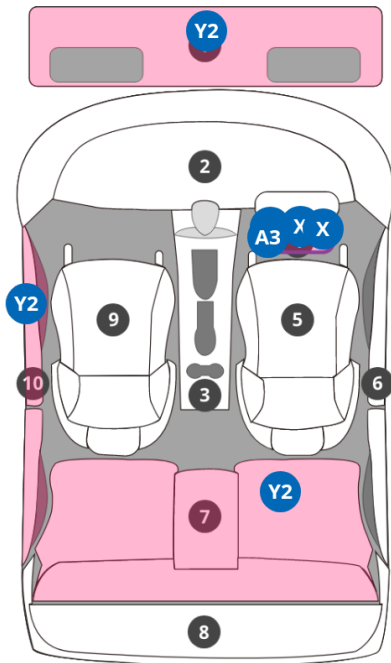
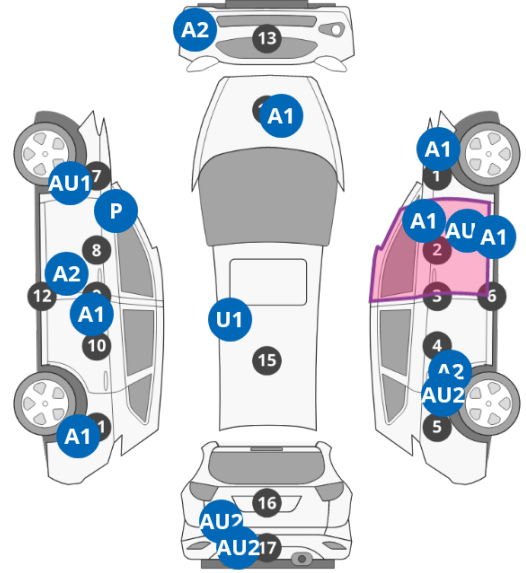
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	111	107	109
2	Boot Lid	114.6	121	115	108
3	Roof	92.1	87	86	102/94
4	Left Front Fender	146.3	148	138	153
5	Left Front Door	147.0	151	149	141
6	Center Panel Left				
7	Left Rear Door	146.3	150	137	152
8	Left Back Panel	148.6	147	168	131
9	Right Front Fender	143.3	147	135	148
10	Right Front Door	156.3	148	147	174
11	Center Panel Right				
12	Right Rear Door	146.6	156	141	143
13	Right Back Panel	140.3	137	140	144

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small</p>		<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Minimal</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes</p>	

Inspector Notes
With Lto plate, with spare tire and jack, 2key, no warranty booklet and tools, scratches on headlights and taillights, splash of cement on body