

General Information

Date & Time: 20, Jan, 2026 14:47

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,023
Registration No.	DBU6406	Chassis No.	PA1B18F35S4287065
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



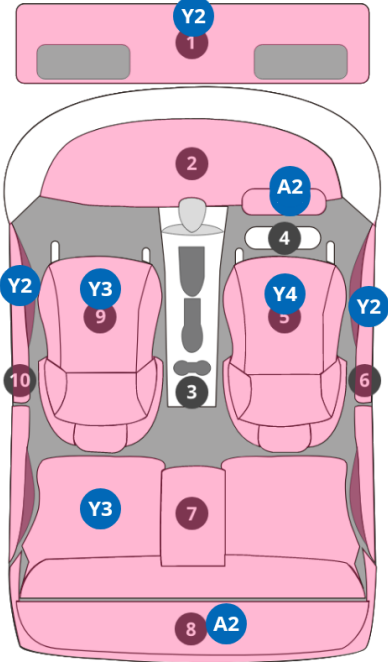
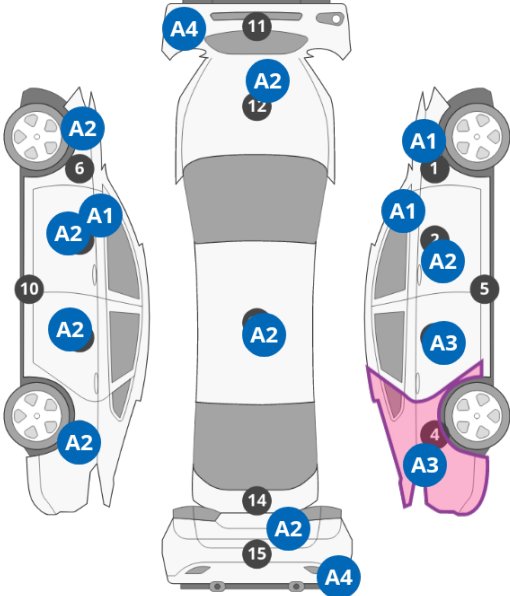
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.1	118	95	103
2	Boot Lid	103.6	98	104	109
3	Roof	92.9	96	97	83/95
4	Left Front Fender	100.0	98	100	103
5	Left Front Door	100.6	102	98	102
6	Center Panel Left				
7	Left Rear Door	91.8	96	91	89
8	Left Back Panel	109.6	118	106	105
9	Right Front Fender	99.0	102	100	95
10	Right Front Door	108.3	108	112	105
11	Center Panel Right				
12	Right Rear Door	102.6	100	103	105
13	Right Back Panel	148.6	173	160	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with reverse camera/with jack and incomplete tools/with warranty booklet/No seat cover</p>