

General Information

Date & Time: 20, Jan, 2026 18:01

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	27,668
Registration No.	FAR2216	Chassis No.	MR0JB8DD4P3549723
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



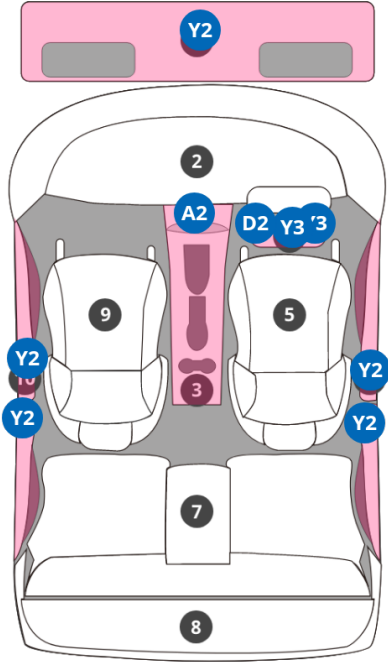
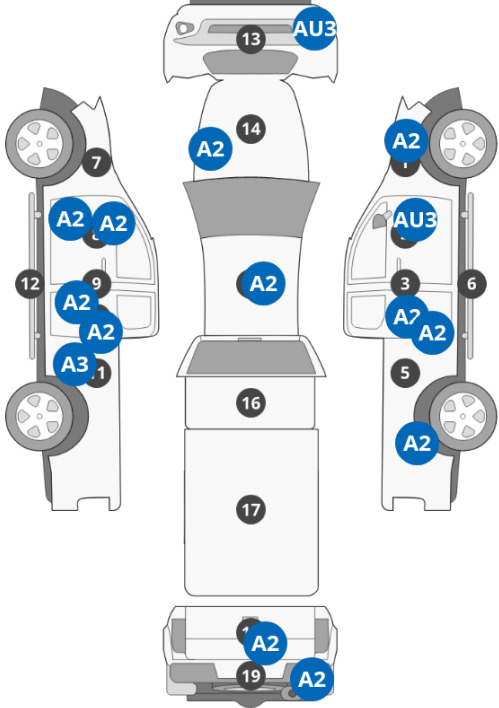
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	120	123	112
2	Boot Lid	110.0	114	107	109
3	Roof	121.2	118	136	124/107
4	Left Front Fender	110.0	113	110	107
5	Left Front Door	118.6	122	119	115
6	Center Panel Left				
7	Left Rear Door	106.0	109	109	100
8	Left Back Panel	123.6	124	125	122
9	Right Front Fender	110.6	106	111	115
10	Right Front Door	114.0	113	118	111
11	Center Panel Right				
12	Right Rear Door	111.0	111	107	115
13	Right Back Panel	118.0	120	122	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Rear Trim - Grime - Small / Mat Other - Grime - Medium / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Corner Panel - Scratch - Small / (R) Side Gate - Scratch - Small / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Side Gate - Scratch - Medium / (L) Rear Corner Panel - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTOplate.</p>