

General Information

Date & Time: 03, Feb, 2026 18:56

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	10,474
Registration No.	NFR3821	Chassis No.	PA1B18F35R4251841
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



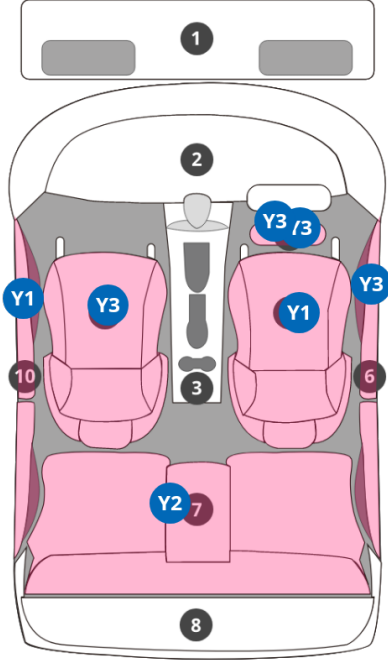
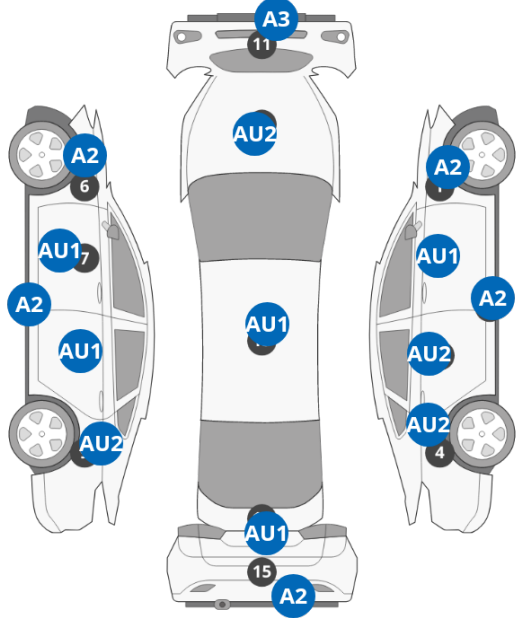
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	121	100	119
2	Boot Lid	120.0	116	119	125
3	Roof	105.7	107	113	103/100
4	Left Front Fender	101.7	100	96	109
5	Left Front Door	99.7	98	100	101
6	Center Panel Left				
7	Left Rear Door	102.0	106	100	100
8	Left Back Panel	112.3	121	112	104
9	Right Front Fender	101.5	101	100	104
10	Right Front Door	107.3	111	102	109
11	Center Panel Right				
12	Right Rear Door	102.7	101	98	109
13	Right Back Panel	106.2	97	108	114

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with tools, with manual and warranty booklet, with reverse camera, scratches on taillight and headlight, no spare key</p>