

General Information

Date & Time: 20, Jan, 2026 15:30

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	77,931
Registration No.	GAP1744	Chassis No.	MHKA4DE5FNJ017742
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



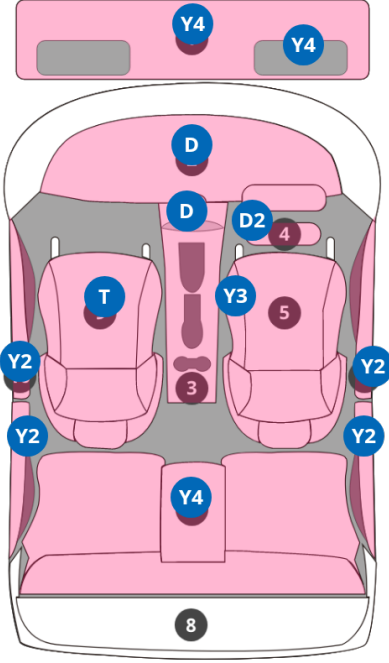
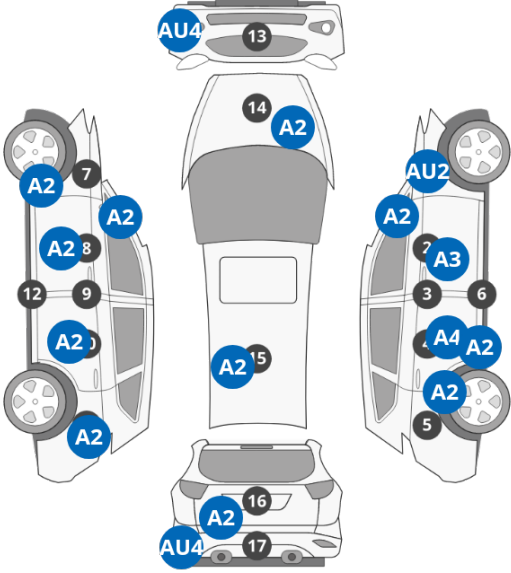
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	195.6	199	208	180
2	Boot Lid	95.9	95	99	94
3	Roof	87.6	85	86	93/87
4	Left Front Fender	167.6	162	165	176
5	Left Front Door	176.3	163	176	190
6	Center Panel Left				
7	Left Rear Door	209.6	183	218	228
8	Left Back Panel	165.6	156	178	163
9	Right Front Fender	250.3	248	240	263
10	Right Front Door	190.3	177	176	218
11	Center Panel Right				
12	Right Rear Door	186.3	181	183	195
13	Right Back Panel	157.3	151	156	165

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Ceiling - Grime - Large / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Cigarette Burns - Burnt / (L) Front Floor Mat - Worked - Small / Sunvisor, Sunglass Holder - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Right side mirror loose. Power folding side mirror issue. Rear seat loose. Crack left tail light. Right foglight assembly missing. Scratches at taillight. Gap at front and rear bumper. Aircon issue. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. No LTO plate.</p>