

General Information

Date & Time: 22, Jan, 2026 08:37

Make	Ford	Model	Fiesta
YOM	2017	Odo Meter Reading	50,563
Registration No.	FAC2022	Chassis No.	MPB8XXMXJ8HM80146
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



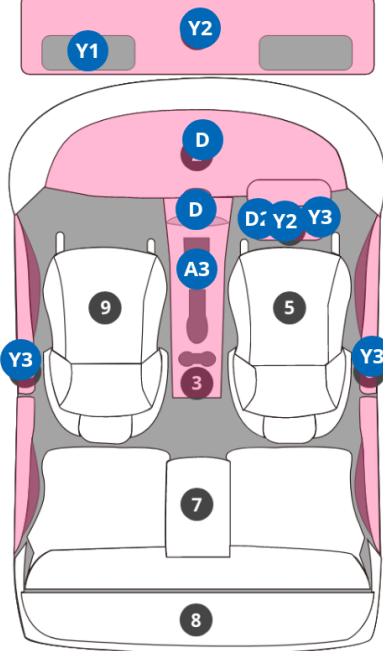
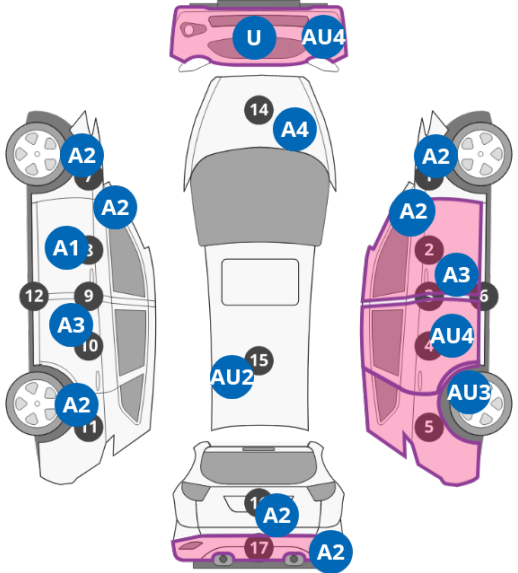
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.6	130	139	123
2	Boot Lid	116.0	99	140	109
3	Roof	116.0	111	107	123/123
4	Left Front Fender	123.3	128	125	117
5	Left Front Door	123.3	132	124	114
6	Center Panel Left				
7	Left Rear Door	124.3	126	134	113
8	Left Back Panel	116.3	113	116	120
9	Right Front Fender	149.3	118	146	184
10	Right Front Door	233.0	309	184	206
11	Center Panel Right				
12	Right Rear Door	167.6	152	154	197
13	Right Back Panel	255.6	298	251	218

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Minimal / Mat Other - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Knobs - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Mirror - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / Roof - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : D
<p>Remarks Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Maintinance warning lamp. Gap at front and rear bumper. Window lock switch issue. Aircon vent center left not working. Front left window molding issue. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>