

General Information

Date & Time: 21, Jan, 2026 13:15

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,928
Registration No.	NHR1513	Chassis No.	PA1B18F31P4227503
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



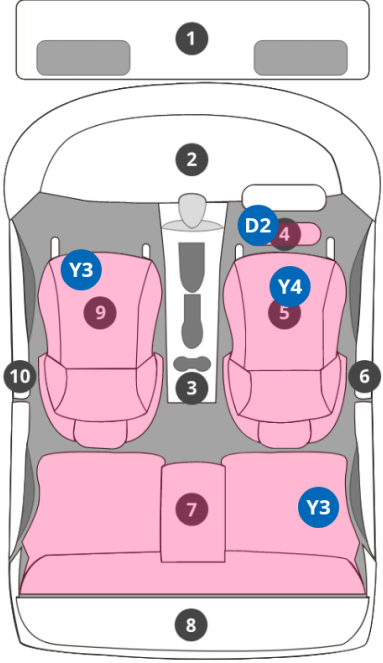
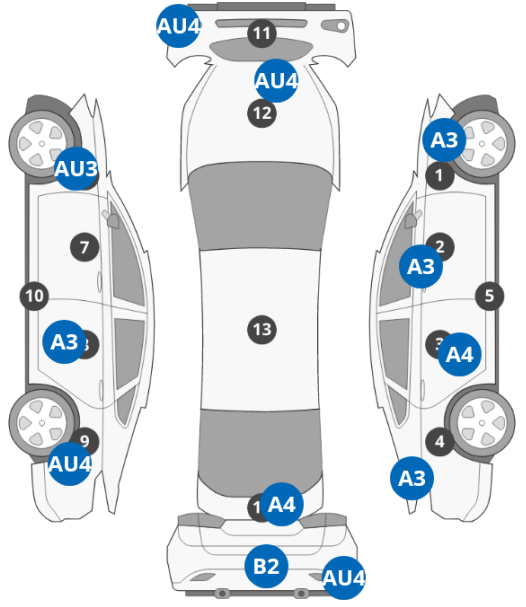
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.0	98	103	99
2	Boot Lid	101.6	102	101	102
3	Roof	102.2	93	99	96/121
4	Left Front Fender	98.3	108	93	94
5	Left Front Door	97.9	92	103	99
6	Center Panel Left				
7	Left Rear Door	98.3	97	100	98
8	Left Back Panel	104.1	90	111	111
9	Right Front Fender	97.1	95	100	97
10	Right Front Door	100.6	97	101	104
11	Center Panel Right				
12	Right Rear Door	101.3	100	103	101
13	Right Back Panel	102.6	102	106	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Modified - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no LTO plate/ no warranty booklet/possible flooding/ incomplete tools / with spare tire and jack</p>