

General Information

Date & Time: 21, Jan, 2026 13:20

| | | | |
|-------------------------|-------------------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2024 | Odo Meter Reading | 44,071 |
| Registration No. | NHS4137 | Chassis No. | PA1B18F32R4259539 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Red Mica Metallic | | |

Body / Panel Condition



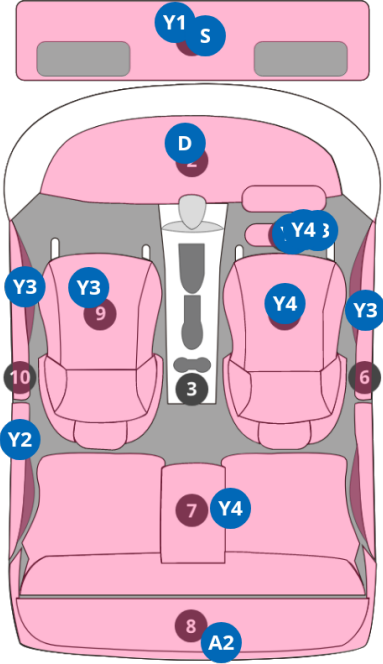
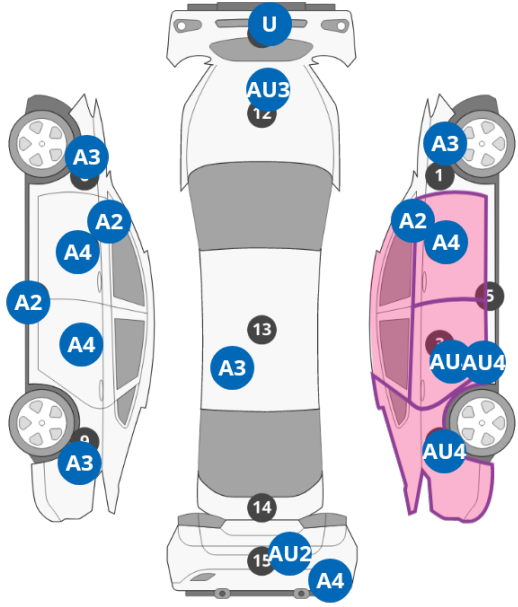
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 103.6 | 120 | 93 | 98 |
| 2 | Boot Lid | 99.9 | 99 | 100 | 101 |
| 3 | Roof | 84.7 | 87 | 87 | 82/83 |
| 4 | Left Front Fender | 86.9 | 87 | 88 | 86 |
| 5 | Left Front Door | 94.9 | 92 | 92 | 101 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 95.7 | 104 | 91 | 92 |
| 8 | Left Back Panel | 103.3 | 119 | 95 | 96 |
| 9 | Right Front Fender | 89.2 | 88 | 88 | 91 |
| 10 | Right Front Door | 237.6 | 417 | 153 | 143 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 221.6 | 174 | 147 | 344 |
| 13 | Right Back Panel | 629.0 | 125 | 589 | 1,173 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|---|
| Interior Evaluation : E | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Large / Rear Seat - Grime - Large / Mat Other - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes</p> | <p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch - Medium</p> |
| Frame Evaluation : A | Functional Evaluation : B |
| <p>Remarks Defects not found</p> | <p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p> |

| |
|--|
| <p>Inspector Notes</p> |
| <p>with LTO plate/No spare tire/No spare key/No jack and tools/with reverse camera/No warranty booklets/No seat cover/possible flooding/interior dirty</p> |