

General Information

Date & Time: 20, Jan, 2026 18:14

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	30,678
Registration No.	NIF9646	Chassis No.	PA1B18F33N4196770
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



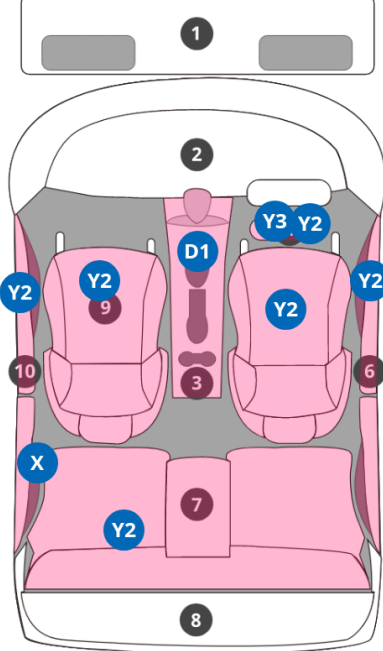
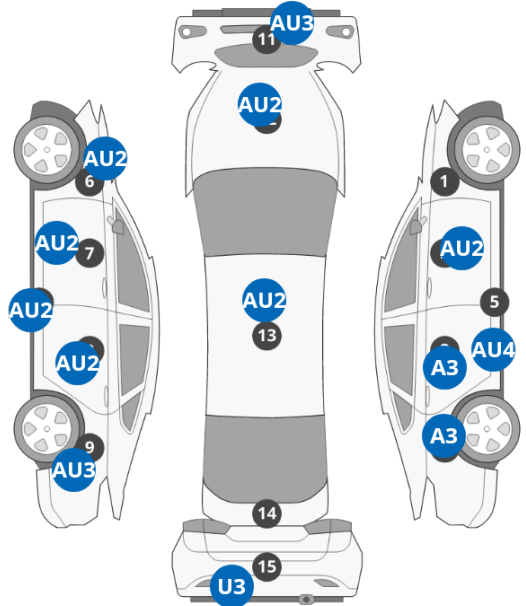
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.1	117	89	115
2	Boot Lid	105.6	106	105	106
3	Roof	93.5	94	91	99/91
4	Left Front Fender	95.4	92	99	95
5	Left Front Door	123.6	117	151	103
6	Center Panel Left				
7	Left Rear Door	100.5	106	103	93
8	Left Back Panel	108.0	117	100	107
9	Right Front Fender	98.3	100	98	97
10	Right Front Door	99.8	101	99	100
11	Center Panel Right				
12	Right Rear Door	101.3	98	103	103
13	Right Back Panel	103.8	97	102	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Console, Switchs, Vents - Loose, Deformed - Minimal / Trim Other - Missing - Yes</p>	<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with warranty and manual booklet, no spare key, no tools, scratches on taillight and headlight</p>