

General Information

Date & Time: 21, Jan, 2026 11:04

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	48,160
Registration No.	NIU4009	Chassis No.	MHFCB3GSXP0493975
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



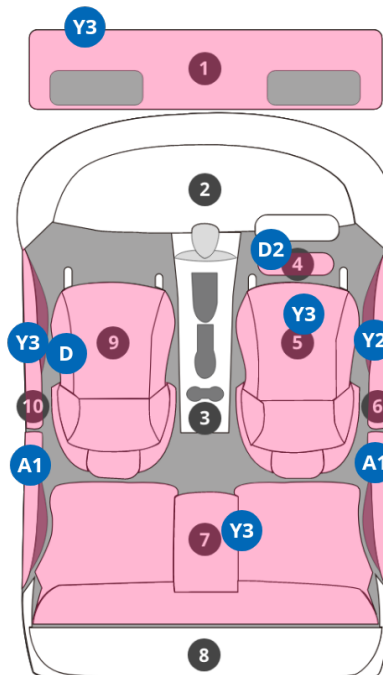
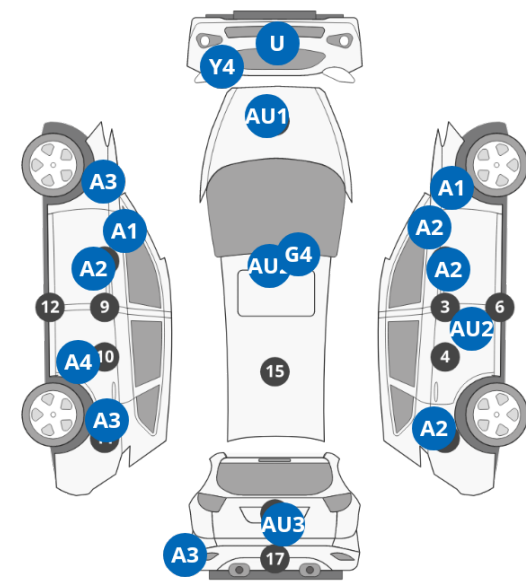
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.0	129	145	116
2	Boot Lid	147.6	139	166	138
3	Roof	116.2	125	131	106/103
4	Left Front Fender	119.6	112	119	128
5	Left Front Door	118.3	124	117	114
6	Center Panel Left				
7	Left Rear Door	106.0	115	103	100
8	Left Back Panel	155.3	161	148	157
9	Right Front Fender	122.3	135	117	115
10	Right Front Door	106.6	114	106	100
11	Center Panel Right				
12	Right Rear Door	232.3	389	181	127
13	Right Back Panel	151.3	156	137	161

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Room Lamp - Stuck - Yes / Ceiling - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (L) Rear Trim - Cut, Crack - Minimal</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / Front Windshield - Scratch, Stone chip - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light, dome light issue, plate light issue</p>