

General Information

Date & Time: 20, Jan, 2026 16:57

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	10,999
Registration No.	NJC1605	Chassis No.	MHFAA1BY0S0041018
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



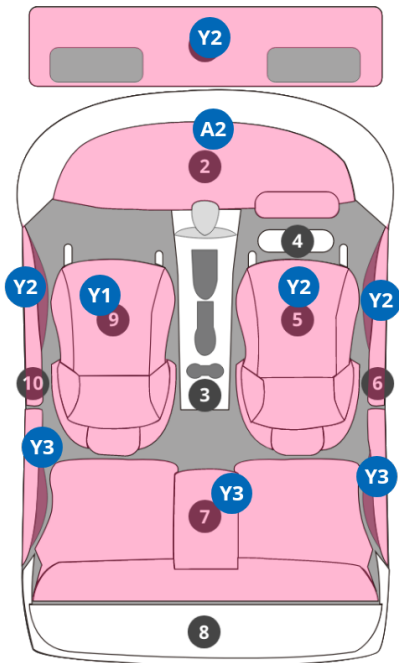
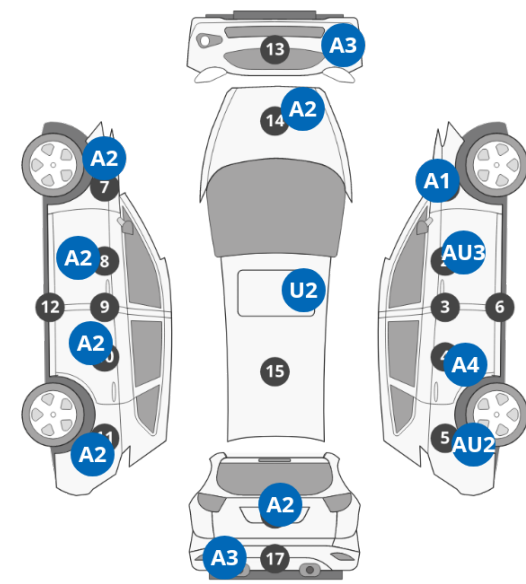
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	98	102	109
2	Boot Lid	89.8	88	97	85
3	Roof	119.0	113	107	150/106
4	Left Front Fender	99.6	97	102	100
5	Left Front Door	114.6	104	114	126
6	Center Panel Left				
7	Left Rear Door	109.6	113	104	112
8	Left Back Panel	111.3	114	107	113
9	Right Front Fender	97.0	99	100	92
10	Right Front Door	106.8	116	107	98
11	Center Panel Right				
12	Right Rear Door	103.8	108	99	105
13	Right Back Panel	100.9	110	93	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Minimal</p>	<p>Remarks (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack No tools/with reverse camera/no seat cover/with warranty booklet</p>