

General Information

Date & Time: 21, Jan, 2026 10:24

Make	Toyota	Model	Raize
YOM	2025	Odo Meter Reading	9,457
Registration No.	NJF6954	Chassis No.	MHKABA1BA9SJ117637
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



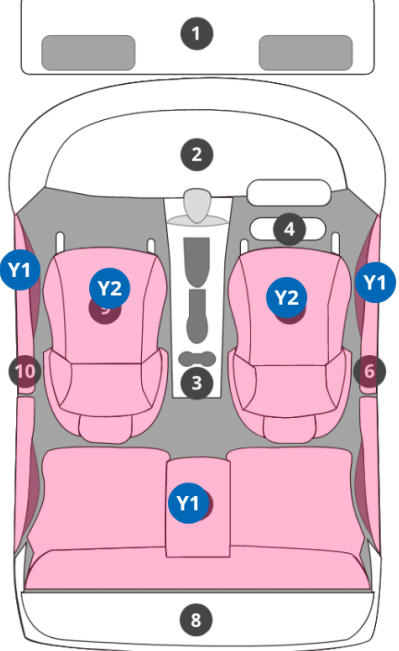
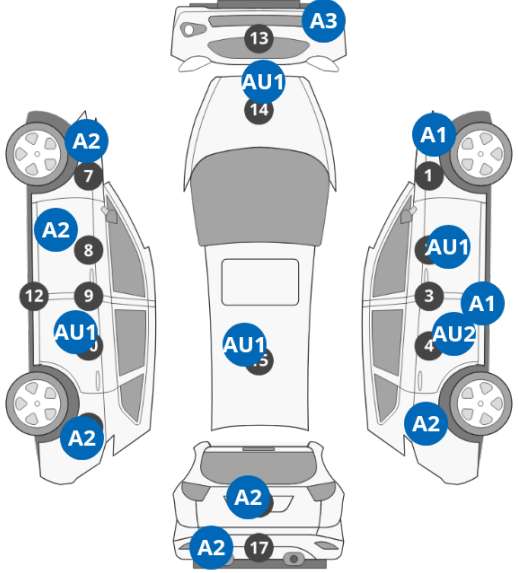
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	100	96	100
2	Boot Lid	83.3	75	99	77
3	Roof	103.4	97	109	110/98
4	Left Front Fender	95.4	88	100	99
5	Left Front Door	100.6	93	109	100
6	Center Panel Left				
7	Left Rear Door	100.6	108	94	100
8	Left Back Panel	85.7	86	79	92
9	Right Front Fender	84.8	93	86	75
10	Right Front Door	90.8	90	95	88
11	Center Panel Right				
12	Right Rear Door	83.6	87	81	83
13	Right Back Panel	79.8	89	78	72

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with incomplete tools and jack, with manual booklet, no spare key, issue on side mirror switch, issue on rightside tailight, scratches on tailight and headlight.</p>