

General Information

Date & Time: 20, Jan, 2026 08:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	12,861
Registration No.	HAG8478	Chassis No.	PA1B18F38R4262557
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



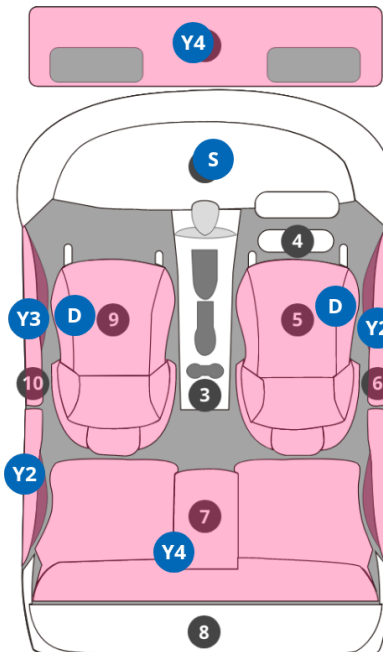
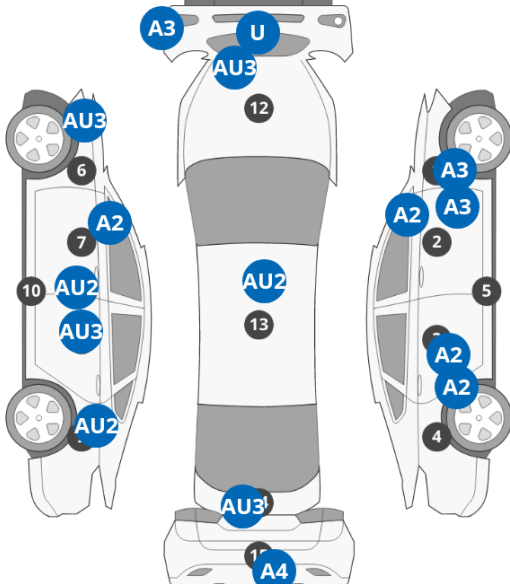
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	111	100	104
2	Boot Lid	106.6	111	100	109
3	Roof	103.5	109	108	101/96
4	Left Front Fender	97.7	102	95	96
5	Left Front Door	103.0	102	101	106
6	Center Panel Left				
7	Left Rear Door	112.0	116	119	101
8	Left Back Panel	112.6	115	116	107
9	Right Front Fender	105.6	109	105	103
10	Right Front Door	101.9	100	100	106
11	Center Panel Right				
12	Right Rear Door	103.8	108	99	104
13	Right Back Panel	110.6	105	107	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Grime - Large / Ceiling - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack, incomplete tools, no spare tire, with LTO plate, possible flooding, scratches on tail light, worn tires</p>