

## General Information

Date & Time: 20, Jan, 2026 19:15

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	17,042
<b>Registration No.</b>	DAV7559	<b>Chassis No.</b>	PA1B18F36M4150316
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



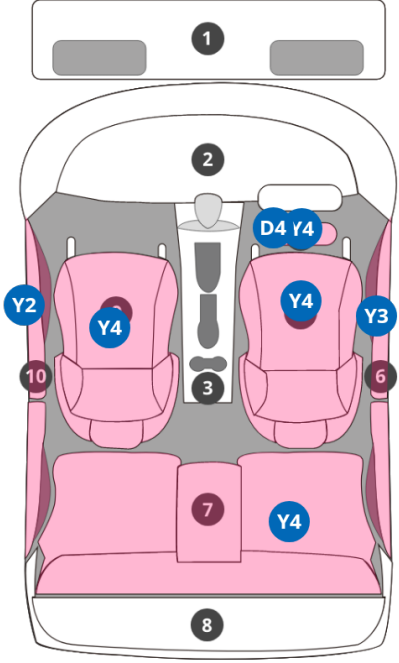
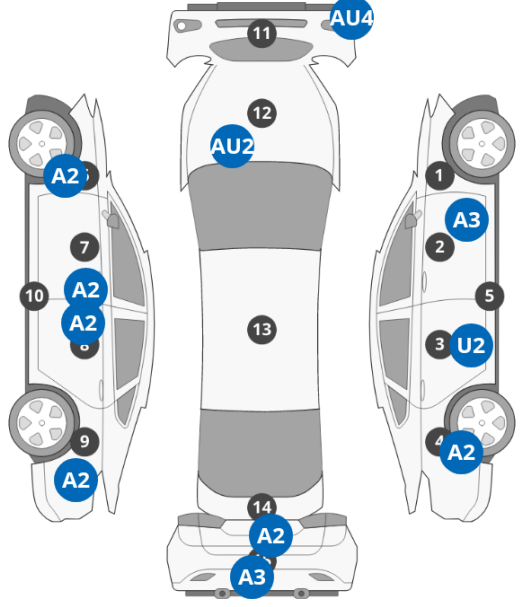
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.9	108	114	96
2	Boot Lid	103.6	101	101	109
3	Roof	97.5	103	94	103/91
4	Left Front Fender	99.3	91	99	109
5	Left Front Door	105.3	102	112	102
6	Center Panel Left				
7	Left Rear Door	99.3	106	96	96
8	Left Back Panel	105.0	106	104	105
9	Right Front Fender	96.2	90	91	108
10	Right Front Door	98.6	95	104	97
11	Center Panel Right				
12	Right Rear Door	95.8	94	93	100
13	Right Back Panel	105.3	105	101	110

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet and LTO plate/ with spare tire and jack/ incomplete tools/ possible flooding/</p>