

General Information

Date & Time: 20, Jan, 2026 13:58

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	14,008
Registration No.	DBF5603	Chassis No.	MR0AB8DD8R5152085
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Red		

Body / Panel Condition



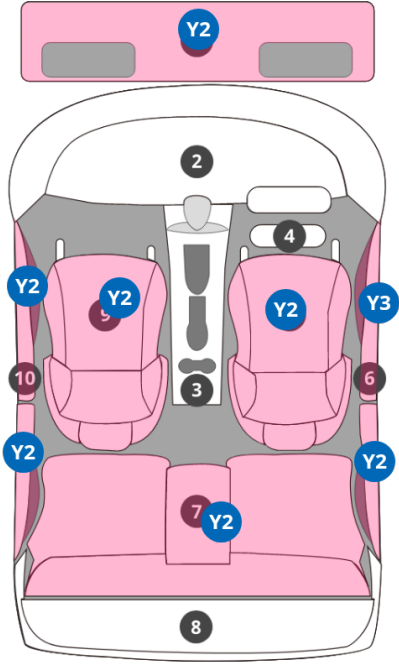
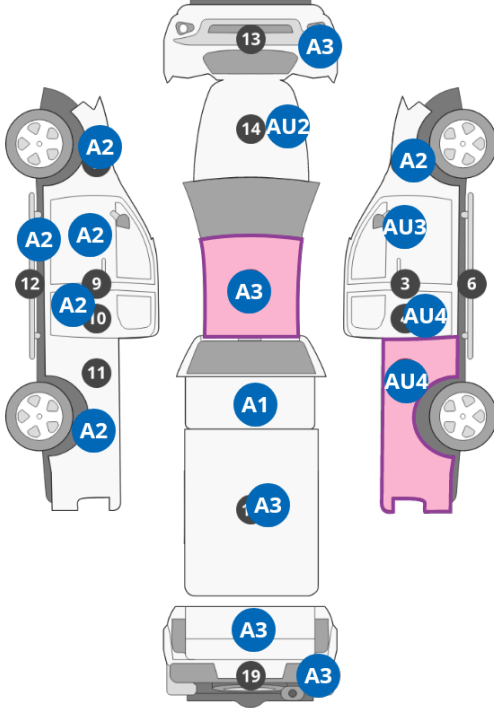
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	111	109	123
2	Boot Lid	89.4	90	88	90
3	Roof	174.0	212	139	165/180
4	Left Front Fender	104.6	108	102	104
5	Left Front Door	105.0	108	102	105
6	Center Panel Left	74.8	114	50	61
7	Left Rear Door	94.8	104	93	88
8	Left Back Panel	115.6	105	130	112
9	Right Front Fender	104.6	112	100	102
10	Right Front Door	106.3	112	101	106
11	Center Panel Right	70.7	88	65	59
12	Right Rear Door	99.0	98	97	102
13	Right Back Panel	105.8	99	113	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks Roof - Repair Traces - Yes / (L) Guard Frame - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Guard Frame - Scratch & Dent - Large / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Cargo Bed Floor - Scratch - Medium / Roof - Scratch - Medium / Cab Back Panel - Scratch - Minimal / (R) Guard Frame - Partially Missing - Yes</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>No LTO plate/with spare tire/with 1 spare key/with jack and tools/with reverse camera/No reverse camera/rear fender partially missing/Front and rear window issue/Unusual sound engine/aircon issue /No warranty booklet</p>