

General Information

Date & Time: 20, Jan, 2026 13:24

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	32,461
Registration No.	DBJ8790	Chassis No.	PA1B18F34P4228077
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



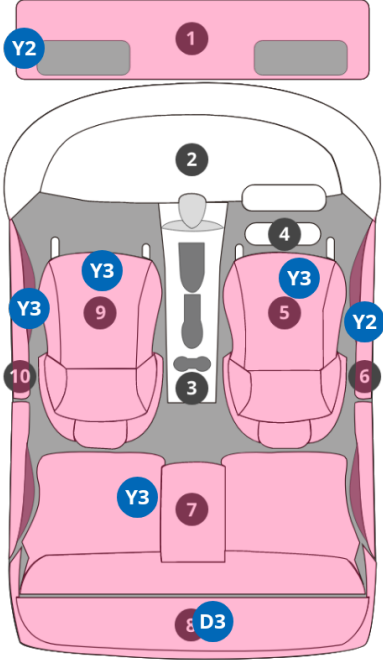
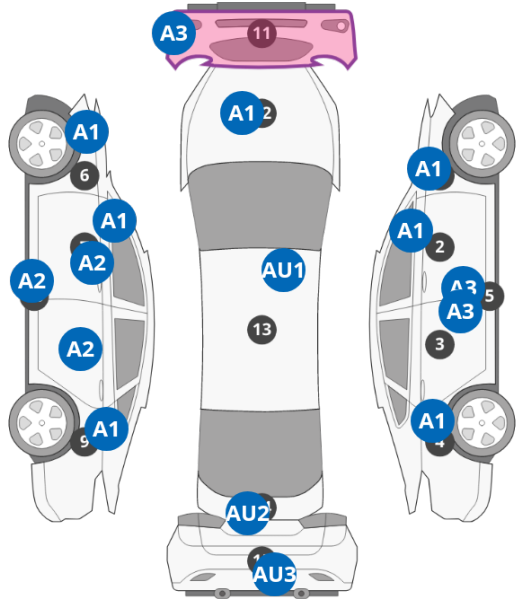
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	113	100	114
2	Boot Lid	114.3	115	111	117
3	Roof	97.6	105	97	93/95
4	Left Front Fender	105.7	106	96	115
5	Left Front Door	106.6	108	104	108
6	Center Panel Left				
7	Left Rear Door	125.6	167	108	102
8	Left Back Panel	121.3	129	126	109
9	Right Front Fender	102.6	101	104	103
10	Right Front Door	101.6	101	104	100
11	Center Panel Right				
12	Right Rear Door	106.6	102	108	110
13	Right Back Panel	106.3	105	102	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Loose, Deformed - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light</p>