

General Information

Date & Time: 23, Jan, 2026 09:53

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	31,108
Registration No.	NID3469	Chassis No.	PA1B18F36N4184922
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



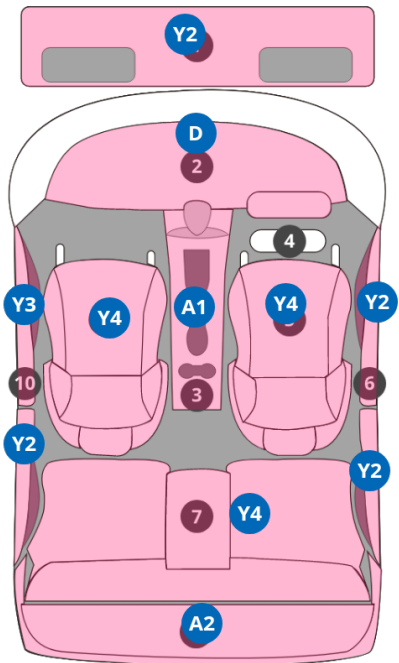
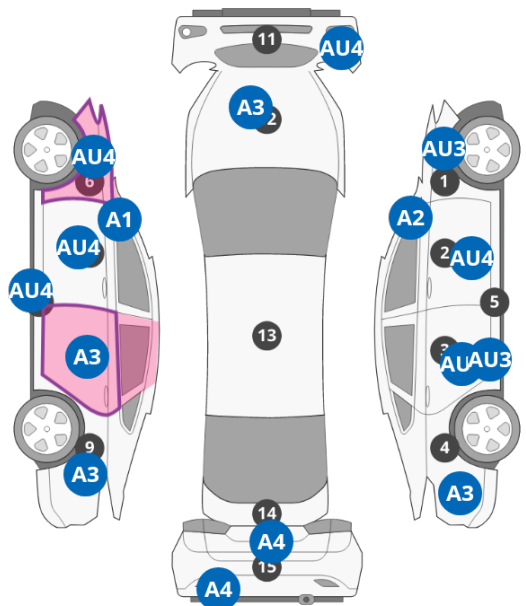
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	94	97	119
2	Boot Lid	94.5	96	93	95
3	Roof	86.0	100	82	81/82
4	Left Front Fender	331.3	133	687	174
5	Left Front Door	142.6	146	144	138
6	Center Panel Left				
7	Left Rear Door	172.3	262	122	133
8	Left Back Panel	101.6	114	98	93
9	Right Front Fender	85.4	89	83	85
10	Right Front Door	93.2	93	88	98
11	Center Panel Right				
12	Right Rear Door	89.7	86	86	98
13	Right Back Panel	93.7	93	89	100

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate /rim only No tire/No spare key/reverse camera not working/right side front door handle damage/with jack and incomplete tools/engine noise/vibration/with warranty booklet/interior dirty/