

General Information

Date & Time: 22, Jan, 2026 15:18

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	82,806
Registration No.	NIF5570	Chassis No.	PA1B18F37N4192365
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



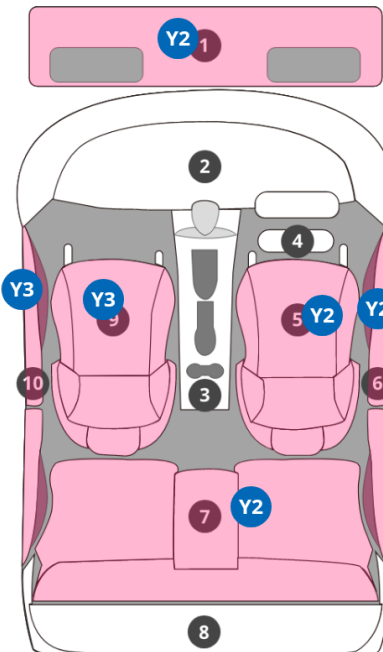
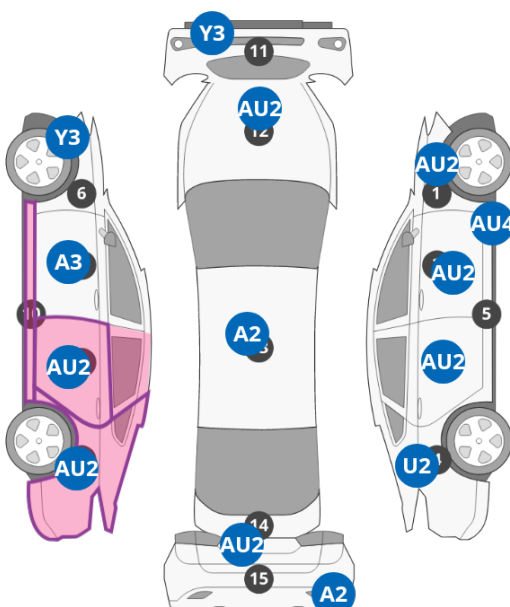
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	119	111	140
2	Boot Lid	110.6	118	104	110
3	Roof	97.4	100	93	95/102
4	Left Front Fender	108.3	108	115	102
5	Left Front Door	99.6	100	99	100
6	Center Panel Left				
7	Left Rear Door	407.6	156	934	133
8	Left Back Panel	127.7	186	98	99
9	Right Front Fender	112.0	111	122	103
10	Right Front Door	106.3	103	106	110
11	Center Panel Right				
12	Right Rear Door	104.0	101	106	105
13	Right Back Panel	106.5	98	102	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Roof - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty and manual booklet, no spare key, no tools and jack, parklight issue, plate light issue, shift/acceleration shock issue, scratches on taillight and headlight.</p>